



Designation: E 1444 – 94a01

An American National Standard

Standard Practice for Magnetic Particle Examination¹

This standard is issued under the fixed designation E 1444; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or ~~reapproval~~.

~~This specification reapproval.~~

This standard has been approved for use by agencies of the Department of Defense.

1. Scope

1.1 This practice establishes minimum requirements for magnetic particle examination used for the detection of surface or slightly subsurface discontinuities in ferromagnetic material. ~~This practice is intended as a direct replacement of MIL-STD-1949.~~ Guide E 709 can be used in conjunction with this practice as a tutorial.

NOTE 1—This Practice replaces MIL-STD-1949.

1.2 The magnetic particle examination method is used to detect cracks, laps, seams, inclusions, and other discontinuities on or near the surface of ferromagnetic materials. Magnetic particle examination may be applied to raw material, billets, finished and semifinished materials, welds, and in-service parts. Magnetic particle examination is not applicable to nonferromagnetic metals and alloys such as austenitic stainless steels. See Appendix X5 for additional information.

1.3 All areas of this Practice may be open to agreement between the Cognizant Engineering Organization and the supplier, or specific direction from the Cognizant Engineering Organization.

1.4 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.

2. Referenced Documents

2.1 The following documents form a part of this standard practice to the extent specified herein.

2.2 *ASTM Standards:*

¹ This practice is under the jurisdiction of ASTM Committee ~~E-7~~ E07 on Nondestructive Testing and is the direct responsibility of Subcommittee E07.03 on Liquid Penetrant and Magnetic Particle Methods.

Current edition approved ~~Nov. 15, 1994~~; Feb. 10, 2001. Published ~~January 1995~~; April 2001. Originally published as E 1444 – 91. Last previous edition E 1444 – 94a.

A 275/A 275M Test Method for Magnetic Particle Examination of Steel Forgings²
A 456 Specification for Magnetic Particle Inspection of Large Crankshaft Forgings²
D 1966 Test Methods for ~~Water and Sediment~~ Foots in Crude Raw Linseed Oil by the Centrifuge Method (Field Procedure)³
E 543 Practice for Evaluating Agencies that Perform Nondestructive Testing⁴
E 709 Guide for Magnetic Particle Examination⁴
E 1316 Terminology for Nondestructive Examinations⁴

2.3 *ASNT Documents:*

~~SNT-TC-1A Recommended Practice No. "Personnel Qualification and Supplement Magnetic Particle Inspection Certification in Nondestructive Testing"~~⁵

ANSI/ASNT CP-189 Standard for Qualification and Certification of NDT Personnel⁵

2.4 *Society of Automotive Engineers (SAE)-AMS Documents:*⁶

AMS 2300 Premium Aircraft- Quality Steel Cleanliness Magnetic Particle Inspection Procedure⁷
AMS 2301 Aircraft Quality Steel Cleanliness Magnetic Particle Inspection Procedure⁷
AMS 2303 Aircraft Quality Steel Cleanliness Martensitic Corrosion Resistant Steels Magnetic Particle Inspection Procedure⁷
AMS 2641 Magnetic Particle Inspection Vehicle⁷
AMS 3040 Magnetic Particles, Nonfluorescent, Dry Method⁷
AMS 3041 Magnetic Particles, Nonfluorescent, Wet Method, Oil Vehicle, Ready-To-Use⁷
AMS 3042 Magnetic Particles, Nonfluorescent, Wet Method, Dry Powder⁷
AMS 3043 Magnetic Particles, Nonfluorescent, Wet Method, Oil Vehicle, Aerosol Packaged⁷
AMS 3044 Magnetic Particles, Fluorescent, Wet Method, Dry Powder⁷
AMS 3045 Magnetic Particles, Fluorescent, Wet Method, Oil Vehicle, Ready-To-Use⁷
AMS 3046 Magnetic Particles, Fluorescent, Wet Method, Oil Vehicle, Aerosol Packaged⁷
AMS 5062 Steel, Low Carbon Bars, Forgings, Tubing, Sheet, Strip, and Plate 0.25 Carbon, Maximum⁷

AMS 5355 Investment Castings⁷

AMS I-83387 Inspection Process, Magnetic Rubber⁷

AS 4792 Water Conditioning Agents for Aqueous Magnetic Particle Inspection⁷

AS 5282 Tool Steel Ring Standard for Magnetic Particle Inspection⁷

AS 5371 Reference Standards Notched Shims for Magnetic Particle Inspection⁷

2.5 *Federal Standards:*⁶

FED-STD-313 Material Safety Data Sheets, Preparation and the Submission of⁸

FED-STD-595 Colors⁸

2.6 *Military Standards:*⁶

MIL-STD-1907 Inspection, Liquid Penetrant and Magnetic Particle Soundness Requirements for Materials, Parts, and Weldments⁸

~~MIL-STD-410 Nondestructive Testing Personnel Qualification and Certification~~⁸

~~MIL-STD-1949 Magnetic Particle Inspection, Method of~~⁸

~~MIL-STD-2175 Castings, Classification and Inspection of~~⁸

~~MIL-STD-45662 Calibration Systems Requirements~~

~~MIL-I-83387 Inspection Process,~~

A-A-59230 Fluid, Magnetic Rubber⁸

~~DoD-F-87935 Fluid, Magnetic Particle Inspection, Suspension (Metric)~~⁸

2.7 *OSHA Document:*⁹

29 CFR 1910.1200 Hazard Communication

2.8 *ANSI Document:*⁶

ANSI/NCSL Z 540-1 General Requirement for Calibration Laboratories and Measuring Test Equipment¹⁰

2.9 *ISO Document:*

ISO 10012-1 Quality Assurance Requirements for Measuring Equipment¹¹

² Annual Book of ASTM Standards, Vol 01.05.

³ Annual Book of ASTM Standards, Vol 05.01.

⁴ Annual Book of ASTM Standards, Vol 03.03.

⁵ Available from American Society for Nondestructive Testing, 1711 Arlingate Plaza, P.O. Box 28518, Columbus, OH 43228-0518.

⁶ Copies of standards, specifications, drawings, and publications required by manufacturers in connection with specification acquisition should be obtained from the contracting activity or as directed by the contracting officer.

⁷ Available from Society of Automotive Engineers, 400 Commonwealth Drive, Warrendale, PA 15096.

⁸ Available from Standardization Documents Order Desk, Bldg. 4 Section D, 700 Robbins Ave., Philadelphia, PA 19111-5094, Attn: NPODS.

⁹ Available from Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402.

¹⁰ Available from National Conference of Standards Laboratories, 1800 30th St. Suite 305b, Boulder, CO. 80301.

¹¹ This practice is under the jurisdiction of ASTM Committee E07 on Nondestructive Testing and is the direct responsibility of Subcommittee E07.03 on Liquid Penetrant and Magnetic Particle Methods.

2.10 *AIA Document:*

NAS 410 Certification and Qualification of Nondestructive Test Personnel¹²

2.11 *DoD Contracts*—Unless otherwise specified, the editions of the documents that are DoD adopted are those listed in the issue of the DoDISS (Department of Defense Index of Specifications and Standards) cited in the solicitation.

2.912 *Order of Precedence*—In the event of conflict between the text of this practice and the referenced documents cited herein, the text of this practice takes precedence.

3. Terminology

3.1 *Definitions*—The definitions relating to magnetic particle examination, which appear in Terminology E 1316, shall apply to the terms used in this practice.

3.2 *Definitions of Terms Specific to This Standard:*

3.2.1 *alternating current (ac) Cognizant Engineering Organization*—an electrical current that reverses its direction of flow at regular intervals.

3.2.2 *ambient light*—the visible light level measured at the specimen surface with the black light(s) on.

3.2.3 *contracting agency*—a prime contractor, subcontractor, company, agency, or government agency procuring magnetic particle inspection services.

3.2.4 *gauss (G)*—the unit of flux density or induction in other authority responsible for the cgs electromagnetic unit system ($1\text{ G} = 10^{-4}\text{ Tesla (T)}$); in air, 1 G is equivalent to 1 oersted (Oe), which equals 79.58 A/m).

3.2.5 *head shot*—the production of circular magnetization by passing current directly through the part being inspected, or central conductor, while being held in contact with the head stocks in a horizontal wet machine.

3.2.6 *magnetic flux*—a conceptualization of the magnetic field intensity based on the line pattern produced when iron filings are sprinkled on paper laid over a permanent magnet. The magnetic field lies in the direction of the flux lines and has an intensity proportional to the line density.

3.2.7 *magnetization*—the process by component for which the elementary magnetic domains of a material are predominantly aligned particle examination is required. This, in one direction.

3.2.8 *retentivity*—the ability of a material addition to retain magnetism after the magnetizing force has been removed. design personnel, may include personnel from material and process engineering, stress analysis, NDT or quality groups and others as appropriate.

4. Significance and Use

4.1 Magnetic particle examination consists of magnetizing the area to be ~~inspected,~~ examined, applying suitably prepared magnetic particles while the area is magnetized, and subsequently interpreting and evaluating any resulting particle accumulations. Maximum detectability occurs when the discontinuity is positioned on the surface and perpendicular to the magnetic flux. ~~In order to detect discontinuities in all directions, at least two magnetic fields, perpendicular to one another in a plane parallel to the surface being inspected, shall be used, except when specifically exempted by the contracting agency.~~ flux.

5. General Practice

5.1 *Acceptance Requirements*—The acceptance requirements applicable to the part or group of parts shall be incorporated as part of the written procedure either specifically or by reference to other applicable documents, such as MIL-STD-1907, containing the necessary information. ~~Applicable drawings or other documents shall specify~~ When parts are zoned, the acceptance size and concentration of discontinuities criteria for the component, with zoning of unique areas as required by design requirements. ~~These acceptance requirements each zone shall be as approved on or as specified by the contracting agency.~~ specified. Methods for establishing acceptance requirements for large crankshaft forgings are covered in Specification A 456. Methods for establishing requirements for steel forgings are covered in Test Method A 275/A 275M. Methods for classifying metal castings are given in MIL-STD-2175 and AMS 5355. ~~MIL-STD-1907 provides a classification scheme for ferromagnetic forgings, castings, extrusions, and weldments.~~ AMS 5355.

5.1.1 *Aircraft-Quality Steel Cleanliness*—The examination of aircraft-quality steel for cleanliness using magnetic particle examination shall be as specified in AMS 2300, 2301, or 2303 as appropriate to the type of steel being inspected. However, inspection of parts fabricated from this material shall be in accordance with the requirements of this practice.

5.2 *Personnel Qualification*—Personnel performing examinations in accordance with this practice shall be qualified ~~and certified~~ in accordance with ASNT Personnel Qualification SNT-TC-1A or MIL-STD-410 for military purposes, Recommended Practice No. SNT-TC-1A, ANSI/ASNT Standard CP-189, NAS 410, or as specified in the contract or purchase order.

5.3 *Agency Qualification*—~~The agency performing~~ If specified in the testing or examination contractual agreement, NDT agencies shall meet; be qualified and evaluated as a minimum, the requirements of Practice E 543, described in E 543. The

Current edition approved Feb. 10, 2001. Published April 2001. Originally published as E 1444 – 91. Last previous edition E 1444 – 94a.

¹² Available from Aerospace Industries Association of America, Inc., 1250 Eye St. NW, Washington D.C. 20005.

applicable edition of E 543 shall be specified in the contractual agreement.

5.4 *Written Procedure*—Magnetic particle examination shall be performed in accordance with a written procedure applicable to the parts or group of parts under ~~testing; examination.~~ The procedure shall be in accordance with the requirements and guidelines of this ~~p~~ Practice. The ~~process, when conducted in accordance with the written procedure,~~ shall be capable of detecting the smallest rejectable discontinuities specified in the ~~acceptance requirements; criteria.~~ The written procedure may be general if it clearly applies to all of the specified parts being ~~tested~~ examined and meets the requirements of this practice. All written procedures, ~~including technique sheets for specific parts,~~ shall be approved by an individual qualified and certified at Level III for magnetic particle examination in accordance with the requirements of 5.2. Procedures shall be submitted to the ~~contracting agency Cognizant Engineering Organization for review and/or approval~~ when requested.

5.4.1 *Elements of the Written Procedure*— The written procedure shall include at least the following elements, either directly or by reference to the applicable documents:

5.4.1.1 Procedure identification number and the date it was written;

5.4.1.2 Identification of the part(s) to which the procedure applies; this shall include the material and ~~alloy of which the parts are fabricated;~~ alloy.

5.4.1.3 Sequence of magnetic particle examination as related to manufacturing process operation, if applicable;

5.4.1.4 Identification of test parts used for system performance verification (see 7.1.21 and 7.1.32);

5.4.1.5 Areas of the part to be examined (include an ~~illustration—either sketch~~ illustration, either a drawing or photo);

5.4.1.6 Part preparation required before ~~testing;~~ examination;

5.4.1.7 Directions for positioning the item with respect to the magnetizing equipment;

5.4.1.8 The type of magnetizing current and the equipment to be used;

5.4.1.9 Method of establishing the magnetization (head, coil, prods, yoke, cable wrap, etc.);

5.4.1.10 Directions of magnetization to be used, the order in which they are applied, and any demagnetization procedures to be used between shots;

5.4.1.11 The current level, or the number of ampere turns, to be used and the duration of its application;

5.4.1.12 Type of magnetic particle material (dry or wet, visible or fluorescent, etc.) to be used and the method and equipment to be used for its application and, for the case of wet particles, the particle concentration limits;

5.4.1.13 Type of records and method of marking parts after examination;

5.4.1.14 Acceptance requirements, to be used for evaluating indications and disposition of parts after evaluation; and

5.4.1.15 Post-examination demagnetization and cleaning requirements.

5.5 *Examination Sequence*—~~When—Perform~~ magnetic particle examination ~~is specified, it shall be performed after the completion of all operations that could which might cause surface or near-surface defects. These reveal discontinuities. Such operations include, but are not limited to, forging, heat treating, plating, passivation, cold electroplating, forming, welding, grinding, straightening, machining, and proof-loading. Unless otherwise approved by the contracting agency or as approved in 6.1.3, production parts shall be loading.~~

5.5.1 *Perform* magnetic particle ~~inspected before the application of any coatings. Also, parts heat treated examination prior to an ultimate tensile strength of 180 ksi or higher that are heat treated shot peening (to provide a beneficial compressive layer) and subsequently electroplated shall prior to applying protective finishes such as priming, painting, plating (see 6.1.2 through 6.1.4.5) or other coatings.~~

5.5.2 *In-process examinations may not be inspected after the electroplating operation.* ~~substituted for final examination.~~

5.6 *Record of Examination*—The results of all magnetic particle ~~inspections examinations~~ shall be recorded. ~~All recorded results shall be identified, filed, and made available for review by the contracting agency upon request. Records shall provide for traceability to the specific part or lot inspected; examined, serial number if serialized, and they shall identify the inspection NDE contractor or facility and the procedures used in the inspection; examination, the lot size, and the number of parts accepted. All recorded results shall be identified, filed, and made available for review by the contracting agency upon request.~~

5.7 *Lighting:*

5.7.1 *Visible Light*—~~Conduct~~ visible light intensity measurements upon initial light installation or when changes occur that would cause the light intensity to change and at the intervals specified in Table 1.

5.7.1.1 *Visible light* shall be used when examining with nonfluorescent ~~particles. The intensity magnetic particles and for interpretation of the visible light at the surface of the part undergoing examination shall be maintained at a minimum of 100 fc (1000 lx). The intensity measurement shall be conducted indications found with a suitable illuminance meter with a photopic spectral response.~~

5.7.1.1 *Ambient Visible Light*—Unless otherwise specified, fluorescent magnetic particle examinations shall be performed in a darkened area with a maximum ambient visible ~~particles. A minimum light-level intensity of 2 100 fc (20 (1000 lx) measured shall be available at the surface of the part surface. undergoing examination or evaluation.~~

5.7.1.2 *Special Ambient Visible Internal Light Source*—~~When—Fluorescent magnetic particle examinations of internal surfaces must shall be performed using special in a darkened area with a maximum ambient visible light sources, the image produced must have sufficient resolution to effectively evaluate the required discontinuities. Light intensity shall be level of 2 fc (20 lx) measured at the expected working distance of the equipment. part surface.~~

5.7.2 *Black Lights*—All ~~inspection~~ black lights shall be checked at ~~meet~~ the intervals specified in Table 1, and after bulb replacement, for output. A longer period may be used if a plan justifying this extension is prepared by the nondestructive testing facility and approved by the contracting agency. ~~requirements of 7.3.5.~~ The minimum acceptable intensity is 1000 $\mu\text{W}/\text{cm}^2$ (10 W/m^2) at the part surface being examined. ~~Black light reflectors and filters~~ lights shall be checked ~~periodaically~~ for cleanliness and integrity. ~~Damaged or dirty reflectors or filters~~ integrity and shall be ~~cleaned~~, replaeired or ~~otherwise corrected~~ replaced as appropriate. ~~Periodic checks of cleanliness/integrity need not be recorded.~~

5.7.3 *Internal Part Restricted Area Examination*—Where lamps are physically too large to directly illuminate the examination surface, special lighting, such as UV pencil lights or UV light guides or borescopes shall be used. ~~Internal features such as bores, holes;~~ The image viewed must have sufficient resolution to effectively evaluate the required discontinuities. Light intensity shall be measured at the expected working distance and passages less than 0.5 in. (12.5 mm) nominal diameter shall not require magnetic particle examination unless otherwise specified by ~~meet~~ the contracting agency. ~~requirements of 5.7.1.1 and 5.7.2 as appropriate.~~

5.8 *Materials:*

5.8.1 *Dry Particle Requirements*—Dry particles shall meet the requirements of AMS 3040. In applying AMS 3040, the particles shall show indications as listed in Table 2 on the test ring specimen of Fig. 1 using the following procedure:

5.8.1.1 Place a conductor with a diameter between 1 and 1.25 in. (25 and 31 mm) and a length longer than 16 in. (40 cm) through the center of the ring. Center the ring on the length of the conductor. Magnetize the ring circularly by passing the current specified in Table 2 through the conductor. Using a squeeze bulb or other suitable applicator, apply the particles to the surface of the ring while the current is flowing. Examine the ring within 1 min after current application under a visible light of not less than 100 fc (1000 lx). The number of hole indications shall meet or exceed those specified in Table 2. ~~AMS 3040.~~

5.8.2 *Wet Particle Requirements*—Wet particles shall meet the requirements of AMS 3041, 3042, 3043, 3044, 3045, or 3046, as applicable. In applying these specifications, the particles shall show indications as listed in Table 2 on the test ring specimen of Fig. 1 using the following procedure:

5.8.2.1 Place a conductor with a diameter between 1 and 1.25 in. (25 and 31 mm) and a length longer than 16 in. (40 cm) through the center of the ring. Center the ring on the length of the conductor. Magnetize the ring circularly by passing the current specified in Table 2 through the conductor. Apply the suspension to the ring using the continuous method. Examine the ring within 1 min after current application (examination of nonfluorescent baths shall be conducted under visible light of not less than 100 fc (1000 lx); examination of fluorescent baths shall be conducted under a black light of not less than 1000 $\mu\text{W}/\text{cm}^2$). The number of hole indications shall meet or exceed those specified in Table 2. ~~applicable.~~


5.8.3 *Suspension Vehicles*—The suspension vehicle for the wet method shall be a light petroleum distillate conforming to AMS 2641 (Type I) or DoD-F-87935, or a suitably conditioned water that conforms to the requirements of 5.8.4. When approved by the contracting agency, AMS 2641 (Type II) may be used. ~~The flash point and viscosity shall be in accordance with~~ When ~~specified,~~ the requirements of AMS 2641 or DoD-F-87935. The background fluorescence of the oil suspension vehicle shall be less than ~~meet the saliment characteristics~~ specified in ~~DoD-F-87935, A-A-59230.~~

TABLE 1 Required Verification Intervals

| Item | Maximum Time Between Verification ^A |
|---|---|
| Lighting: | |
| Lighting:^B | |
| Black light intensity | 1 day |
| Black light intensity | weekly |
| Ambient light intensity | 1 day |
| Ambient light intensity | weekly |
| Visible light intensity | 1 day |
| Visible light intensity | daily |
| System Performance using the test piece or ring specimen of Fig. 1 | 1 day |
| System Performance:^B (7.1, 7.1.1, 7.1.2) | daily |
| Wet particle concentration | 8 hours, or every shift change |
| Wet particle concentration (7.2.1.1) | 8 hours, or every shift change |
| Water break test | 1 day |
| Wet particle contamination:^B (7.2.1.2) | 1 week |
| Wet particle contamination | 1 week |
| Water break test (7.2.2) | daily |
| Equipment calibration check: | |
| Equipment calibration check:^B | |
| Gaussmeter reading (Teslameter) zero | Prior to Use |
| Gaussmeter reading (Teslameter) zero | 6 months |
| Gaussmeter (Teslameter) accuracy | 6 months |
| Ammeter accuracy | 6 months |
| Timer control | 6 months |
| Quick break | 6 months |
| Dead weight check | 6 months |

^A When the inspection system is in operation.

^B The maximum time between verifications may be reduced or extended when substantiated by actual technical/reliability data.

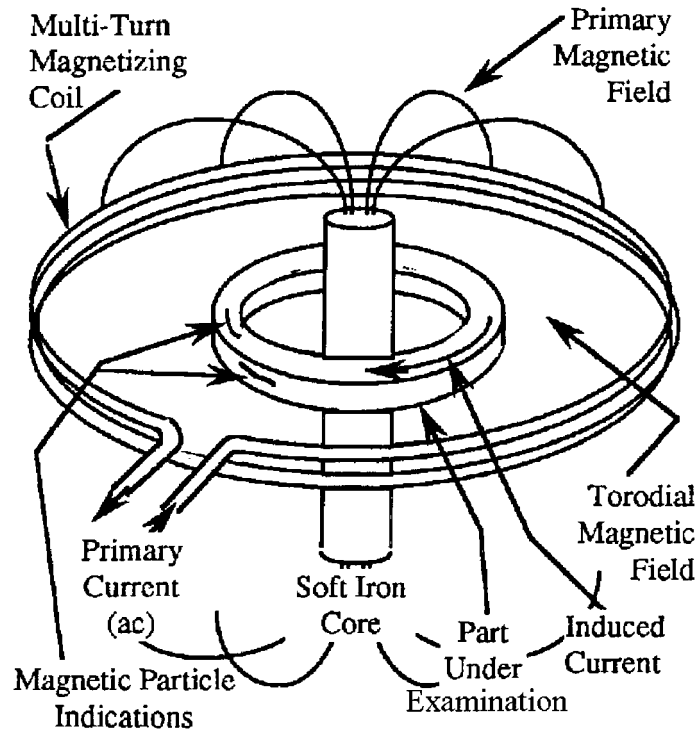

The primary current sets up an oscillating field.
 This primary magnetic field induces a current in the ring shaped part under examination

FIG. 1 Example of Induced Current Magnetization

5.8.4 *Conditioned Water Vehicle*—When water is used as a suspension vehicle for magnetic particles, the conditioning agents used shall be conditioned suitably to provide for proper wetting, particle dispersion, and corrosion protection, comply with AS 4792. Proper wetting shall be determined by a water break test (see 7.1-4.2). Smoother test surfaces generally require that a greater percent of wetting agent be added than rough surfaces. Nonionic wetting agents are recommended. However, wetting agent additions shall be controlled in all cases by pH measurements to limit the alkalinity. Foaming of the suspension bath must be minimized to a maximum pH of 10.0 and the acidity to a minimum pH of 6.0. point that it does not interfere with the inspection process.

5.8.5 *Particle Concentration*—The concentration of particles in the test suspension bath shall be as specified in the written procedure. Particle concentrations outside of the range of 0.1 to 0.4 mL/ml in a 100-mL bath sample for fluorescent particles and 1.2 to 2.4 mL/ml in a 100 ml sample for nonfluorescent particles shall not be used unless authorized by the contracting agency used. Fluorescent particles and nonfluorescent particles shall not be used together.

6. Specific Practice

6.1 Preparation of Parts for Test Examination :

6.1.1 *Preinspection Demagnetization*— The part shall be demagnetized before examination if prior operations have produced a residual magnetic field that may interfere with the examination.

6.1.2 *Surface Cleanliness and Finish*— The surface of the part to be inspected examined shall be essentially smooth, clean, dry, and free of oil, scale, machining marks, or other contaminants or conditions that might interfere with the efficiency of the inspection-examination.

6.1.3 *Coatings*—Magnetic particle examination shall not be performed with coatings in place that could prevent the detection of surface defects in ferromagnetic substrate. Such coatings normally include paint or chrome plate greater than 0.003 in. (0.08 mm) in thickness and ferromagnetic coatings such as electroplated nickel greater than 0.001 in. (0.03 mm) in thickness. If coatings greater than these limits are present during examination, it must be demonstrated that the minimum rejectable discontinuities can be detected through the maximum coating thickness applied. When such coatings are nonconductive, they must be removed where electrical contact is to be made. In high stress applications when detection of fine defects such as grinding cracks and nonmetallic stringers is required, examination with coatings in place shall be performed only when it has been verified that the minimum rejectable discontinuities can be detected in the presence of the coating.

6.1.4 *Plugging and Masking*—Unless otherwise—Plugging and masking is required when specified by the contracting agency, small openings Cognizant Engineering Organization.

6.1.4 *Plating and oil holes leading Coatings*—Examine parts which will receive either a plating or coating as follows:

6.1.4.1 Examination is required prior to all non-electroplated coatings.

6.1.4.2 Examination is required prior to electroplating when the final plating thickness will exceed 0.0008 in (0.02 mm).

6.1.4.3 Examination is required after electroplating and or cavities that could entrap or remain contaminated grinding of electroplated surfaces with inspection media shall be plugged with a suitable nonabrasive material that can be removed readily and, in the case of engine parts, following exceptions: 1) magnetic particle examination is not required for plating thickness' greater than 0.005 in. Effective masking shall be used (0.13 mm) and 2) magnetic particle examination is not required for steels with a tensile strength less than or equal to protect those components, such 160 ksi.

6.1.4.4 Use caution when examining parts with an electroplated nickel coating as certain nonmetallies, that indications may be form in the nickel plating itself.

6.1.4.5 For in-service examination, plating or coatings do not require removal prior to examination unless they are damaged by contact or they interfere with the suspension examination process.

6.2 Magnetization Methods:

6.2.1 Types of Magnetizing Current—The types of currents used for magnetic particle examination are full-wave rectified alternating (FWDC) current (3 (1 or 3 phase), half-wave rectified alternating (HWDC) current, and alternating (AC) current. The equipment used shall fulfill the magnetizing and demagnetizing requirements adequately, as outlined herein, without damage to the part under testing, examination, and they shall include the necessary features required for safe operation.

6.2.2 Permanent Magnets—Permanent magnets are not to be used for magnetic particle examination unless specifically authorized by the contracting agency. Cognizant Engineering Organization. When permanent magnets are used, adequate magnetic field strength shall be established in accordance with 7.1.5.4-7.3.4.

6.2.3 Yokes—When using yokes (electromagnetic probes) for magnetic particle examination, adequate magnetic field strength shall be established in accordance with 7.1.5.4-7.3.4.

6.2.4 Magnetizing Current Application— Alternating current is to be used only for the detection of defects open to the surface. Full-wave rectified alternating current has the deepest possible penetration and must be used for inspection for defects below the surface when using the wet magnetic particle method. Half-wave rectified alternating current is advantageous for the dry powder method because it creates a pulsating unidirectional field that gives increased mobility to the particles.

6.2.5 Magnetic Field Directions—Discontinuities are difficult to detect by the magnetic particle method when they make an angle less than 45° to the direction of magnetization. To ensure the detection of discontinuities in any direction, each part must be magnetized in at least a minimum of two directions at approximately right angles to each other. Depending on part geometry, this may consist of circular magnetization in two or more directions, of both multiple circular and longitudinal magnetization, or of longitudinal magnetization in two or more directions. Exceptions necessitated by part geometry, size, or other factors require specific approval of the contracting agency. Cognizant Engineering Organization.

6.2.6 Multidirectional Magnetization— Multidirectional magnetization may be used to fulfill the requirement for magnetization in two directions if it is demonstrated that it is effective in all critical areas. Artificial flaws that are etched Test parts in accordance with 6.3.1.1 or shims manufactured to the requirements of AS 5371, or as shown otherwise approved by a device equal to Fig. 2, may the Cognizant Engineering Organization, shall be used to establish verify field direction. It is vitally important that direction, strength, and balance in multidirectional magnetization. Balance of the field intensity is critical. The field intensity shall

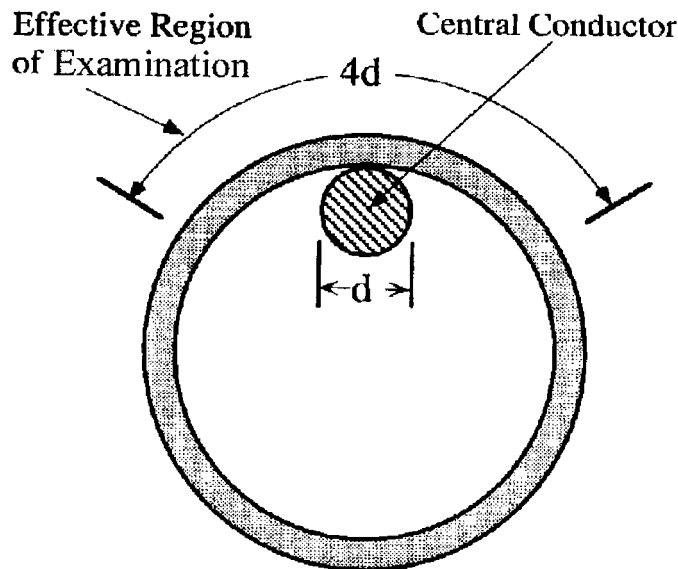


FIG. 2 The Effective Region of Examination When Using an Offset Central Conductor is Equal to Four Times the Diameter of the Conductor as Indicated

be balanced in all directions so that one direction does not overwhelm another direction. In using this method, the directions. The particle application must be timed so that the magnetization reaches its levels reach full value in all directions during while the time particles are mobile on the surface under testing (that is, the continuous method). examination.

6.2.7 *Direct Magnetization*—Direct magnetization is accomplished by passing current directly through the part under testing. examination. Electrical contact is made to the part using head and tail stock, prods, clamps, magnetic leeches, or by other means. ~~Precaution~~ Caution shall be taken to ensure that the electrical current is not flowing while contacts are being applied or removed and that excessive heating does not occur in the contact area. Unless otherwise specified by the contracting agency; Cognizant Engineering Organization, prods shall not be used for the examination of aerospace components (flight hardware) or on finished surfaces.

6.2.8 *Indirect Magnetization*—Indirect part magnetization uses pre-formed coils, cable wraps, yokes, field (flux) flow fixtures, or a central conductor to produce induce a magnetic field of suitable strength and direction to magnetize the in a part under test. when no electrical contact is made.

6.2.9 *Induced Current Magnetization*— Induced current magnetization (toroidal or circumferential field) is accomplished by inductively coupling a part to an electrical coil to create a suitable current flow in the part as illustrated in Fig.-3 1. This method is often advantageous on ring-shaped parts with a central aperture and with an *L/D* ratio less than three, especially where the elimination of arcing or burning is of vital importance.

6.3 *Magnetic Field Strength:*

6.3.1 *Magnetic Field Strength*—The applied magnetic field shall have sufficient strength to produce satisfactory indications, but it must not be so strong that it causes the masking of relevant indications by nonrelevant accumulations of magnetic particles. Factors that determine the required field strength include the size, shape, and material permeability of the part, the technique of magnetization, the method of particle application, and the type and location of the discontinuities sought. Adequate magnetic field strength may be determined by one or a combination of three methods:

6.3.1.1 By testing examining parts having known or artificial defects discontinuities of the type, size, and location specified in the acceptance requirements or by using the notched shims as defined in Appendix X2;

6.3.1.2 By using a Hall effect probe gaussmeter capable of measuring the peak values of the tangent field; and

6.3.1.3 By using the current levels specified in sections 6.3.4 or 6.3.5 or the formulas given in 6.3.7.1-6.3.7.4.

6.3.2 When using Appendix X4. These current levels and formulas provide only a Hall effect probe gaussmeter, tangential field strengths, measured on the part surface, rough guide and shall be used in conjunction with another field strength monitoring method.

6.3.2 Tangential-field strengths in the range of 30 to 60-G (2.4 Gauss [G] (30 to 4.8 kAm⁻¹) peak values 60×10^{-4} Tesla [T]) measured at the part surface are normally adequate magnetization levels for magnetic particle examination. It is important to ensure examination when using a Hall effect probe gaussmeter. Insure that field strengths in this range are present in all areas of the part to be examined. Current levels that provide a 30 to 60 G (30 to 60×10^{-4} T) field may be used instead of the current levels specified in paragraphs 6.3.4 and 6.3.5 or the current used in the formulas of Appendix X4.

6.3.3 *Magnetization Current Levels*—The current values given are peak average current values and are applied directly to full-wave rectified current. For other types of current, the operator's manual or the equipment manufacturer should be consulted

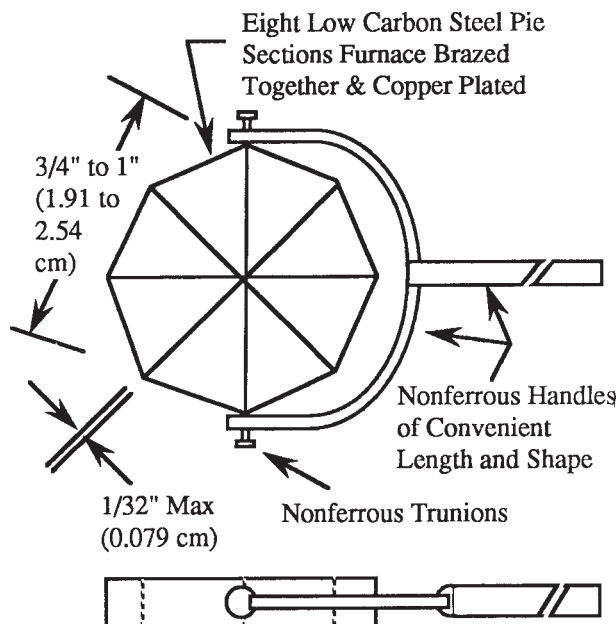


FIG. 3 Pie-field Indicator for Use in Magnetic Particle Examination

to determine what correction factor, if any, is to be used to convert the meter reading to equivalent peak currents. consulted.

6.3.4 *Prod Current Levels*—When using prods on material $\frac{3}{4}$ in. (19 mm) in thickness or less, 90 to 115 A/in. of prod spacing (3.5 to 4.5 A/mm) shall be used. For material greater than $\frac{3}{4}$ in. (19 mm) in thickness, 100 to 125 A/in. of prod spacing (4.0 to 5.0 A/mm) shall be used. Prod spacing shall not be less than 2 in. (50 mm) or greater than 8 in. (200 mm). The effective width of the magnetizing field when using prods is one fourth of the prod spacing on each side of a line through the prod centers.

6.3.5 *Direct Circular Magnetization*—When magnetizing by passing current directly through the part (~~that is, using head shots~~), the nominal current shall be from 300 to 800 A/in. of part diameter (12 to 32 A/mm). The diameter of the part shall be taken as the greatest distance between any two points on the outside circumference of the part. Currents will normally be 500 A/in. (20 A/mm) or lower, with the higher currents (~~up to 800 A/in. (32 A/mm)~~) being used to ~~inspect~~ examine for inclusions or to ~~inspect~~ examine low-permeability alloys such as precipitation-hardened steels. ~~For tests used to locate inclusions in precipitation-hardened steels, even higher currents, up to 1000 Amperages of less than 300 A/in. (40 A/mm), may be used when part configuration dictates and approval is obtained from the Level III and the Cognizant Engineering Organization.~~

6.3.6 *Central Conductor Circular Magnetization*—Circular magnetization may be provided by passing current through a conductor that ~~passes through the~~ is positioned inside of the part. In this case, alternating current is to be used only when the sole purpose of the test is to ~~inspect~~ examine for surface discontinuities on the inside surface of the part. If only the inside of the part is to be ~~inspected~~, examined, the diameter shall be the greatest distance between two points, 180 degrees apart on the inside circumference. Otherwise, the diameter is determined as in 6.3.5. ~~The following two paragraphs cover centrally located and offset central conductors: 6.3.5.~~

6.3.6.1 *Centrally Located Conductor*—When the axis of the central conductor is located near the central axis of the part, the same current levels as given in 6.3.5 shall apply.

6.3.6.2 *Offset Central Conductor*—When the conductor ~~passing through the~~ that is positioned inside of the part is placed against an inside wall of the part, the current levels as given in 6.3.5 shall apply, except that the total diameter shall be considered the sum of the diameter of the central conductor and plus twice the wall thickness of the part. The distance along the part circumference (interior) that ~~is~~ may be effectively magnetized ~~examined~~ shall be taken as approximately four times the diameter of the central conductor, as illustrated in Fig. 4. ~~conductor up to 360 degrees provided the presence of suitable fields is verified.~~ The entire circumference shall be ~~inspected~~ examined by rotating the part on the conductor, allowing for approximately a 10 % magnetic field overlap. See Fig. 2 for an illustration.

6.3.7 *Longitudinal Magnetization Using Coils*—Longitudinal magnetization is often accomplished by passing current through a coil encircling the part, or section of the part, to be ~~tested~~ examined (that is, by using a coil shot). This produces a magnetic field parallel to the axis of the coil. ~~For low or intermediate fill factor coils, the~~ The effective field extends a distance on either side of the coil center approximately equal to the radius of the coil (see Fig. 5). ~~For cable wrap or high-fill factor coils, the coil. The actual effective distance of magnetization is 9 in. (230 mm) must be demonstrated based on either side of the coil center (see Fig. 6).~~ particular part to be examined. For parts longer than these effective distances, the entire length shall be ~~inspected~~ examined by repositioning the part within the coil, allowing for approximately 10 % effective magnetic field overlap. See Appendix X4 for formulas that can be used in coil magnetization.

6.34 *Particle Application:*

6.74.1 *Dry Magnetic Particle Application, Continuous Method*—When using dry particles, the flow of magnetizing current shall be initiated prior to application of the magnetic particles to the surface under examination and terminated after powder application has been completed and any excess blown off. Precautions shall be taken to prevent any damage to the part due to overheating.

6.4.1.1 Apply dry powder so that a light, uniform, dust-like coating settles on the surface of the part under examination while the part is being magnetized. Specially designed powder blowers or shakers using compressed air or hand power shall be used. The applicators shall introduce the particles into the air in a manner such that they reach the part surface in a uniform cloud with a minimum of force.

6.4.1.2 After the powder is applied, and before the magnetizing force is removed, excess powder shall be removed, if it interferes with interpretation and evaluation, by means of a dry air current with sufficient force to remove the excess particles, but not strong enough to disturb particles held by a leakage field that is indicative of discontinuities. In order to recognize the broad, fuzzy, lightly held powder patterns formed by near-surface discontinuities, the formation of indications must be observed carefully during both powder application and removal of the excess powder. The dry particle method shall not be used to examine aerospace components (flight hardware).

6.4.2 *Wet Magnetic Particle Application, Continuous Method*—Fluorescent or nonfluorescent particles suspended in a liquid vehicle at the required concentration shall be applied by gently spraying or flowing the suspension over the area to be examined or by immersion of the part in the suspension.

6.4.2.1 Proper sequencing and timing of part magnetization and application of particle suspension are required to obtain the proper formation and retention of indications. This requires that the stream of suspension be diverted from the part simultaneously with, or slightly before, energizing the magnetic circuit.

6.4.2.2 The magnetizing current shall be applied for a duration of at least $\frac{1}{2}$ s for each application, with a minimum of two shots being used. The second shot shall follow the first in rapid succession. It should come after the flow of suspension has been

interrupted and before the part is examined for indications.

6.4.2.3 Under special circumstances, such as the use of automated equipment or for critical parts, the ½ s duration and the two-shot requirement may be waived provided it is demonstrated that the procedure can detect known discontinuities in reference parts.

6.4.2.4 Care shall be exercised to prevent any damage to the part due to overheating or other causes. Weakly held indications on highly finished parts are readily washed away, and hence care must be exercised to prevent high-velocity flow over critical surfaces.

6.4.3 Residual Magnetization Method— In the residual magnetization method, the magnetic particles are applied to the part under examination immediately after the magnetizing force has been discontinued. The residual method is not as sensitive as the continuous method. It can be useful, for example, in detecting service induced fatigue cracks on the surface of materials with high retentivity. It is also useful for the examination of parts or areas of parts which, because of geometric constraints, cannot be examined with the continuous method. The residual method shall be used only when specifically approved by the Cognizant Engineering Organization or when it has been documented that it can detect discontinuities or artificial discontinuities in parts under examination. The test parts shall have the same material and processing steps, and similar geometry to, the actual parts being examined.

6.4.4 Magnetic Slurry/Paint Application— Magnetic paints or slurries are applied to the part with a brush, squeeze bottle, or aerosol can before or during the magnetization operation. This method is for special applications, such as overhead or underwater examination. This method may be used only when specifically approved by the Cognizant Engineering Organization.

6.4.5 Magnetic Polymer Application— Polymerizable material containing magnetic particles shall be held in contact with the part under examination during the period of its cure. Before curing takes place, and while the magnetic particles are still mobile, the part shall be magnetized to the specified level. This requires prolonged or repeated periods of magnetization. This method is for special applications, such as bolt holes which cannot be examined readily by the wet or dry method, and shall be used only when specifically approved by the Cognizant Engineering Organization. AMS-I-83387 establishes the examination process for magnetic rubber.

6.5 Evaluation— Following magnetization and particle application, the parts shall be examined for indications. All indications will be identified as relevant or nonrelevant. Relevant indications will be compared to accept/reject criteria and the parts accepted or rejected accordingly.

6.6 Recording of Indications— When required by the cross-sectional area written procedure, the location of all rejectable indications shall be marked on the part, and permanent records of the location, direction, and frequency of indications may be made by one or more of the following methods:

6.6.1 Written Description— By recording the location, length, direction, and number of indications in sketch or tabular form.

6.6.2 Transparent Tape— For dry particle indications, by applying transparent adhesive-backed tape to which the indications will adhere and placing it on an approved form along with information giving its location on the part.

6.6.3 Strippable Film— By covering the indication with a spray-on strippable film that fixes the indications in place and placing the resultant reproduction on an approved form along with information giving its location on the part.

6.6.4 Photography— By photographing or video recording the indications themselves, the tape, or the strippable film reproduction and placing the photograph in a tabular form along with information giving its location on the part.

6.7 Post Examination Demagnetization and Cleaning — All parts shall be demagnetized and cleaned after final examination. Apply corrosion protection as required.

6.7.1 Demagnetization:

6.7.1.1 When using AC demagnetization, the part shall be subjected to a field with a peak value greater than, and in nearly the same direction as, the field used during examination. This AC field is then decreased gradually to zero. When using an AC demagnetizing coil, hold the part approximately 1 ft (30 cm) in front of the coil and then move it slowly and steadily through the coil and at least 3 ft (100 cm) beyond the end of the coil while the current is flowing. Repeat this process as necessary. Rotate and tumble parts of complex configuration while passing through the field of the coil.

6.7.1.2 When using DC demagnetization, the initial field shall be higher than, and in nearly the same direction as, the field reached during examination. The field shall then be reversed, decreased in magnitude, and the process repeated (cycled) until an acceptably low value of residual field is reached.

6.7.1.3 Whenever possible, parts that have been magnetized circularly shall be magnetized in the longitudinal direction before being demagnetized. After demagnetization, a magnetic field probe or strength meter shall not detect fields with an absolute value above 3 G (3×10^{-4} T) anywhere on the part.

6.7.2 Postinspection Cleaning— Cleaning shall be done with a suitable solvent, air blower, or by other means.

6.7.2.1 Parts shall be examined to ensure that the cleaning procedure has removed magnetic particle residues from holes, crevices, passage ways, etc. Such residue could have an adverse effect on the intended use of the part.

6.7.2.2 Care shall be taken to remove all plugs, masking, or other processing aids that may affect the intended use of the part.

6.7.2.3 Parts shall be protected from corrosion or damage as required.

7. Quality Control

7.1 System Performance Verification— The overall performance of the magnetic particle examination system, including the

equipment, materials, and the lighting environment being used, shall be verified initially and at regular intervals thereafter. The required verification intervals are stated in Table 1. Records of the verification results shall be maintained and retained for the time period specified in the contract. Establish a system in accordance with ANSI Z540-1 or ISO 10012-1 for calibration and certification of all current and voltage measuring devices, ammeter shunts, timers, and gaussmeters used in verification.

7.1.1 Use of Test Parts with Discontinuities—A reliable method for examination system verification is the use of representative reference parts containing discontinuities of the type, location, and size specified in the acceptance requirements and examined (or inspected) in accordance with a written procedure. If correct magnetic particle indications can be produced and identified in these representative parts, the overall system and examination procedure is verified. Parts used for verification will be demagnetized, cleaned thoroughly following the examination, and checked under black or visible light, as appropriate to the examination process, to ensure that residual indications do not remain.

7.1.2 Fabricated Test Parts with Artificial Discontinuities—When actual production parts with known discontinuities of the type, location, and size needed for verification are not available or are impractical, fabricated test or production parts with artificial discontinuities or a ring specimen similar to the ring in Appendix X1 may be used. Artificial discontinuities may be fabricated to meet a particular need or may be commercially available magnetic field indicators or shims as shown in Appendix X2 and Fig. 3. Artificial-flaw devices are tools to determine the quality and the direction of magnetic fields and are not quantitative devices. All applicable conditions for the use of such reference parts, as described in 7.1.1, shall apply.

7.2 Suspension Vehicle Tests (Not required for aerosol can solutions):

7.2.1 Concentration/Contamination Tests— Particle concentration and contamination shall be determined upon start up, at regular intervals thereafter, and whenever the bath is changed or adjusted. The required testing intervals are stated in Table 1.

7.2.1.1 Determination of Wet Particle Concentration—Agitate the particle suspension a minimum of 30 min to ensure uniform distribution of particles throughout the bath. Place a 100-ml sample of the agitated suspension in a pear-shaped centrifuge tube (of the size and shape specified in Test Method D 1966, except the stem shall be graduated to 1 ml in 0.05-ml increments for fluorescent particles and graduated to 1.5 ml in 0.1 ml increments for visible particles). Demagnetize the sample and allow the tube to stand undisturbed for a settling time of at least 60 min if using petroleum distillate or 30 min for conditioned water suspension. Read the volume of settled particles. If the concentration is out of the tolerance stated in the written procedure add particles or suspension vehicle, as required, and re-determine the particle concentration. If the settled particles appear to be loose agglomerates rather than a solid layer, take a second sample. If the second sample also appears agglomerated, replace the entire suspension. Thirty-minute settling times (for oil suspensions), or other accelerated tests, may be used if they have been verified to give results equivalent to the cross-sectional area procedure described in this paragraph.

7.2.1.2 Determination of Wet Particle Contamination—Perform the tests specified in 7.2.1.1. Examine the graduated portion of the tube, under both black light (for fluorescent baths only) and visible light (for both fluorescent and nonfluorescent baths), for striations or bands, different in color or appearance. Bands or striations may indicate contamination. If the total volume of the contaminants, including bands or striations, exceeds 30 % of the volume of magnetic particles the bath must be adjusted or replaced.

7.2.2 Water Break Test—In this test of water-based vehicles, a clean part being inspected, with a surface finish the same as the parts to be examined or an actual production part is flooded with the conditioned water, and the appearance of the surface is noted after flooding is stopped. If a continuous even film forms over the entire part, sufficient wetting agent is present. If the film of suspension breaks, exposing bare surface, insufficient wetting agent is present or the part has not been cleaned adequately.

7.3 Equipment Calibration—Magnetic particle examination equipment shall be checked for performance and accuracy at the time of purchase and at intervals thereafter as indicated in Table 1; whenever malfunction is suspected, when specified by the Cognizant Engineering Organization, or whenever electrical maintenance that might affect equipment accuracy is performed.

7.3.1 Ammeter Accuracy—To check the equipment ammeter, a calibrated ammeter shall be connected in series with the output circuit. Comparative readings shall be taken at three output levels encompassing the useable range of the equipment. The equipment meter reading shall not deviate by more than $\pm 10\%$ or 50 amperes, whichever is greater, from the current value shown by the calibrated ammeter. (When measuring half-wave rectified current, the current values shown by the calibrated DC ammeter readings shall be doubled.) The frequency of the ammeter check is specified in Table 1.

7.3.2 Timer Control Check—On equipment using a timer to control the current duration, the timer should be calibrated to within ± 0.1 s using a suitable electronic timer.

7.3.3 Magnetic Field Quick Break Check— On equipment that uses a quick break feature, proper functioning of this circuit shall be verified. The test may be performed using a suitable oscilloscope or other applicable method as specified by the equipment manufacturer.

7.3.4 Dead Weight Check—Yokes and permanent magnets (when allowed) shall be dead weight tested at intervals as stated in Table 1. Alternating current and permanent magnet yokes shall have a lifting force of at least 10 lb. (4.5 kg), with a 2 to 6 inch (50 to 150 -mm) spacing between legs. Direct current yokes shall have a lifting force of at least 30 lb. (13.5 kg), with a 2 to 4-in (50 to 100-mm) spacing between legs, or 50 lb. (22.5 kg), with a 4 to 6-in (100 to 150-mm) spacing.

7.3.5 Black Lights—Black lights, portable, hand-held, permanently mounted or fixed, which are used to inspect parts, shall be checked for output at the frequency specified in Table 1 and after bulb replacement. A longer period may be used if a plan justifying this extension is prepared by the NDT facility or its delegate. Minimum acceptable intensity is 1000 mW/cm² at 15 inches (38.1

cm) from the front of the filter to the face of the sensor. All black light filters shall be replaced or otherwise corrected as appropriate.

7.4 Marking of Accepted Parts—Unless otherwise specified by the Cognizant Engineering Organization, parts that have been accepted using magnetic particle examination shall be marked in accordance with the applicable drawing, purchase order, contract, or as specified herein prior to leaving the examination facility.

7.4.1 Marking shall be applied in such a manner and location as to be harmless to the part. The identification shall not be obliterated or smeared by subsequent handling and, when practicable, placed in a location that will be visible after assembly.

7.4.1.1 When subsequent processing would remove the identification, the applicable marking shall be affixed to the record accompanying the finished parts or assembly.

7.4.1.2 Bolts and nuts and other fastener products may be identified as having met the requirements of magnetic particle examination by marking each package conspicuously.

7.4.2 Impression Stamping, Ink Stamping, Laser Marking, Dyeing, Vibro Engraving or Etching—Impression stamping, ink stamping, laser marking, dyeing, vibro engraving or etching may be used when permitted or required by the applicable written procedure, detail specification or drawing, or when the nature of the part is such as to provide for impression stamping of part numbers or other examination personnel markings. Impression stamping shall be located only in the area provided adjacent to the part number or examination personnel's stamp.

7.4.3 Other Identification—Other means of identification, such as tagging, may be used for parts that have a configuration or function precluding the use of stamping, vibro engraving, or etching, as in the case of completely ground or polished balls, rollers, pins, or bushings.

7.5 Identifying Symbols and Color Markings:

7.5.1 One-Hundred Percent Examination—When items are examined and accepted by 100 % examination, each item shall be marked as follows:

7.5.1.1 Dyeing—When dyeing is applicable, a dye of acceptable adherence which is predominantly blue (per FED-STD-595) shall be employed. However, if a color conflict is incurred with any other method, magnetic particle examination may be indicated by two adjacent blue dots or other suitable means.

7.5.1.2 Stamping, Laser Marking, Vibro Engraving, or Etching—When impression stamping or ink stamping, laser marking, vibro engraving, or etching is used to mark 100 % examined parts, the letter “M” with a circle around it shall be employed.

7.5.2 Marking Accepted Lots—When items are accepted by means of a sampling procedure, each item of an accepted lot shall be marked as follows:

7.5.2.1 Dyeing—When dyeing is applicable, a dye of acceptable adherence that is predominantly orange (per FED-STD-595) shall be employed.

7.5.2.2 Stamping, Laser Marking Vibro Engraving, or Etching N_l—When impression stamping, vibro engraving or etching is used to mark lot examined parts, the letter “M”, without a circle around it shall be employed.

7.6 Eye Glasses—When using fluorescent materials, examination personnel shall not wear eye glasses that are photochromic or that have permanently darkened lenses. This is not intended to prohibit the use of eyeglasses with lenses treated to absorb ultraviolet light.

7.7 Safety—The safe handling of magnetic particles (wet or dry), oil vehicles, water baths, and water conditioner concentrates are governed by the suppliers' Material Safety Data Sheets (MSDS). Material Safety Data Sheets, conforming to 29 CFR 1910.1200, or equivalent, must be provided by the supplier to any user and shall be prepared in accordance with FED-STD-313.

7.7.1 Flammability—Flash point of oil vehicles shall be in accordance with AMS 2641. The suppliers' MSDS shall certify the flash point.

7.7.2 Personnel Hazards—Precautions against inhalation, skin contact, and eye exposure are detailed in the suppliers' MSDS. These precautions shall be observed.

7.7.3 Electrical Hazards—Magnetizing equipment shall be maintained properly to prevent personnel hazards from electrical short circuits. Care must be taken to reduce arcing and the possible ignition of oil baths.

7.7.4 Black Light—Replace cracked or broken ultraviolet filters immediately. Broken filters can continue to radiate ultraviolet energy and must be replaced immediately. Spectacles designed to absorb ultraviolet wavelength radiation are suggested for close, high black light intensity, examination.

7.8 Dark Adaptation—Personnel must wait at least 1 minute after entering a darkened area for their eyes to adjust to the low-level lighting before performing fluorescent magnetic particle examination.

8. Keywords

8.1 dye; fluorescent; magnetic particle; nondestructive evaluation; nondestructive examination; nondestructive testing

ANNEX

(Mandatory Information)

A1. INSTRUCTIONS FOR THE USE OF AS 5371 STANDARD NOTCHED SHIMS

A1.1 Application of Shims—The Reference Standard Notched Shims of AS 5371, as shown in Appendix X2, require specific handling, attachment, and care for accurate indication of magnetic field strength and direction. To select amperage settings for multi-directional magnetization, the use of AS 5371 shims is mandatory unless otherwise specified by the Cognizant Engineering Organization.

A1.2 Shims 0.002 inch (0.05 mm) thick shall be used on curved or complex surfaces.

A1.3 Shims are manufactured of low carbon steel and must be protected from corrosion when not in use. They may be submerged in a solvent such as MEK or naphtha for storage. Before attaching the shim to the part, both the shim and part shall be clean and dry.

A1.4 The shim shall be placed in intimate contact with the part with the flaw side next to the material to be tested.

A1.5 The shim shall be securely fastened to the part by using an adhesive or tape (such as Scotch Brand 191, 471, or 600 series) that prevents the magnetic particle suspension from entering between the shim and part.

A1.6 Tape may be used to secure the shim and shall have the following properties: (1) Good adhesion to steel, (2) Impervious to the suspension used, and (3) the tape shall be non-fluorescent (for fluorescent suspensions).

A1.7 If the tape becomes loose, allowing the suspension to seep under the shim, the tape and shim shall be carefully removed, the shim and the part shall be cleaned and the shim shall be reattached.

A1.8 Re-use of the shims is acceptable, provided they are not distorted when removed and intimate contact is achieved when replaced.

A1.9 Determining Field Strength and Direction—Use of the circle or cross configuration shims will indicate fields in any direction.

A1.9.1 In developing a magnetic particle procedure, first determine the locations the shims should be placed to ensure adequate coverage to monitor the field strength and direction, and then attach the shims.

A1.9.2 Using the continuous method, begin by starting the amperage selection at a minimum level and increasing the amperage slowly until the shim indication(s) is readily observed. When magnetized, one leg of the X will be indicated perpendicular to the field direction and the circle shim will show in the areas that are approximately perpendicular to the direction of the applied field.

A1.9.3 In multi-directional magnetization, longitudinal and circular fields shall be determined separately as follows.

A1.9.3.1 Field strength for the first direction shall be determined by slowly increasing the amperage until a satisfactory indication on each shim is observed.

A1.9.3.2 Record the setting.

A1.9.3.3 Carefully clean the shims prior to determining the amperage in the next direction.

A1.9.3.4 Field strength for the second direction shall be determined by incrementally increasing the amperage until a satisfactory indication on each shim is observed.

A1.9.3.5 Record the setting.

A1.9.4 Place the selector switch in the multi-directional mode and magnetize the part at the recorded settings. If the entire circle on the shims is observed, the fields are in balance. If any portion of the circle has a weak indication, adjust the amperage accordingly and repeat field verification process until the magnetic fields are balanced.

A1.9.5 Use care when applying the suspension to the shims. Proper shim indications may not form unless the suspension is applied in a gentle manner.

A1.10 The shims are made of a low retentivity and high permeability material that cannot be used for indicating residual fields when developing magnetic particle inspection procedures.

A1.11 Actual field strength measurements can be obtained by placing a Hall Effect probe adjacent to the shim or at a nearby location where probe placement can easily be repeated.

APPENDIXES

(Nonmandatory Information)

X1. TOOL STEEL RING SPECIMEN FOR SYSTEM PERFORMANCE TEST

X1.1 A ring specimen similar to Fig. X1.1 may be used to perform the system performance tests of section 7.1.

X1.2 *Wet Particle Test.* (Conducted in accordance with a written procedure.)

X1.2.1 Place a non-ferromagnetic conductor with a diameter between 1 and 1.25 in. (25.4 and 31.75mm) and a length of 16 in. (406.4mm) or more through the center of the ring.

X1.2.2 Center the ring on the conductor.

X1.2.3 Magnetize the ring circularly by passing the required current through the conductor. Use the current levels of Table X1.1, Table X1.2, and/or the written procedure.

X1.2.4 Apply the suspension to the ring using the continuous method.

X1.2.5 Examine the ring within 1 min. after current application.

X1.2.5.1 Nonfluorescent baths shall be examined under visible light of not less than 100 fc (1000 lx).

X1.2.5.2 Fluorescent baths shall be examined under black light of not less than 1000 $\mu\text{W}/\text{cm}^2$ and an ambient light level not greater than 2 fc (20 lx).

X1.2.5.3 The number of hole indications visible shall meet or exceed those specified in Table X1.1, Table X1.2, and/or the written procedure.

X1.2.5.4 Current levels used and number of holes observed may be limited by equipment current capacity.

X1.3 *Dry Particle Test.* (Conducted in accordance with a written procedure.)

X1.3.1 Place a non-ferromagnetic conductor with a diameter between 1 and 1.25 in. (25.4 and 31.75mm) and a length of 16 in. (406.4 mm) or more through the center of the ring.

X1.3.2 Center the ring on the conductor.

X1.3.3 Magnetize the ring circularly by passing the required current through the conductor. Use the applicable current levels of Table X1.1, Table X1.2, and/or the written procedure.

X1.3.4 Apply the particles to the ring using a squeeze bulb or other suitable applicator while the current is flowing.

X1.3.5 Examine the ring within 1 min. after current application under a minimum of 100 fc (1000 lx) of visible light.

X1.3.5.1 The number of hole indications visible shall meet or exceed those specified in Table X1.1, Table X1.2, and/or the written procedure.


X1.3.5.2 Current levels used and number of holes observed may be limited by equipment current capacity. †

TABLE X1.1 Amperage and Hole Indication Requirements for AS 5282 Rings

| <u>Type of Suspension</u> | <u>Amperage FWDC or HWDC</u> | <u>Minimum Number of Holes Indicated</u> |
|------------------------------------|----------------------------------|--|
| <u>Fluorescent Oxide (Wet)</u> | 500 | 3 |
| | 1000 | 5 |
| | 1500 | 6 |
| | 2500 | 7 |
| | 3500 | 9 |
| <u>Visible Oxides (Wet)</u> | 500 | 3 |
| | 1000 | 4 |
| | 1500 | 5 |
| | 2500 | 6 |
| | 3500 | 8 |
| <u>Dry Powder</u> | 500 | 4 |
| | 1000 | 6 |
| | 1500 | 7 |
| | 2500 | 8 |
| | 3500 | 9 |

TABLE X1.2 Amperage and Hole Indication Requirements for Ketos 01 Tool Steel Rings

| Type of Suspension | Amperage FWDC or HWDC | Minimum Number of Holes Indicated |
|----------------------------|--------------------------|--------------------------------------|
| Fluorescent Oxide (Wet) | 1400 | 3 |
| | 2500 | 5 |
| | 3400 | 6 |
| Visible Oxides (Wet) | 1400 | 3 |
| | 2500 | 5 |
| | 3400 | 6 |
| Dry Powder | 1400 | 4 |
| | 2500 | 6 |
| | 3400 | 7 |

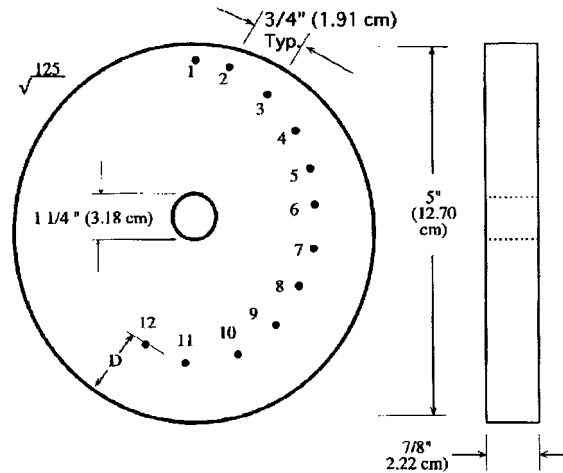

| Hole | 1 | 2 | 3 | 4 | 5 | 6 |
|----------|------------|------------|------------|------------|------------|------------|
| Diameter | 0.07 | 0.07 | 0.07 | 0.07 | 0.07 | 0.07 |
| Note 1 | (1.78 mm) | (1.78 mm) | (1.78 mm) | (1.78 mm) | (1.78 mm) | (1.78 mm) |
| "D" | 0.07 | 0.14 | 0.21 | 0.28 | 0.35 | 0.42 |
| Note 2 | (1.78 mm) | (3.56 mm) | (5.33 mm) | (7.11 mm) | (8.89 mm) | (10.67 mm) |
| Hole | 7 | 8 | 9 | 10 | 11 | 12 |
| Diameter | 0.07 | 0.07 | 0.07 | 0.07 | 0.07 | 0.07 |
| Note 1 | (1.78 mm) | (1.78 mm) | (1.78 mm) | (1.78 mm) | (1.78 mm) | (1.78 mm) |
| "D" | 0.49 | 0.56 | 0.63 | 0.70 | 0.77 | 0.84 |
| Note 2 | (12.45 mm) | (14.22 mm) | (16.00 mm) | (17.78 mm) | (19.56 mm) | (21.34 mm) |

NOTE 1—All hole diameters are ± 0.005 in. (± 0.13 mm). Rings with holes 10 thru 12 are optional.

NOTE 2—Tolerance on the D distance is ± 0.005 in. (± 0.13 mm).

NOTE 3—All other dimensions are ± 0.03 in. (± 0.76 mm).

FIG. X1.1 ANSI KETOS Steel Tool Ring

X2. REFERENCE STANDARD NOTCHED SHIMS FOR MAGNETIC PARTICLE INSPECTION PER AS 5371

X2.1 The following standard flawed shims are typically used to establish proper field direction and ensure adequate field strength during technique development in magnetic particle examination. The shims of Fig. X2.1 may be used to ensure the establishment and balance of fields in the multidirectional magnetization method.

X2.1.1 The shims are available in two thicknesses, 0.002 in. (0.05 mm) and 0.004 in. (0.10 mm). Thinner shims are used when the thicker shims cannot conform to the part surface in the area of interest.

X2.1.2 The shims are available in two sizes, 0.75 in. (19 mm) square for Figs. X2.1 and X2.2 and 0.79 in. (20 mm) square of Fig. X2.3. The shims of Fig. X2.3 are cut, by the user, into four 0.395 in. (10 mm) square shims for use in restricted areas.

X2.2 Shims shall be low carbon steel, AMS 5062 or equivalent.

X2.3 Shims shall be used as specified in AS 5371. Shims are placed in the area(s) of interest with the notches toward the surface of the part being examined. Use enough shims or place the shim in multiple areas to ensure proper field directions and strengths are obtained.

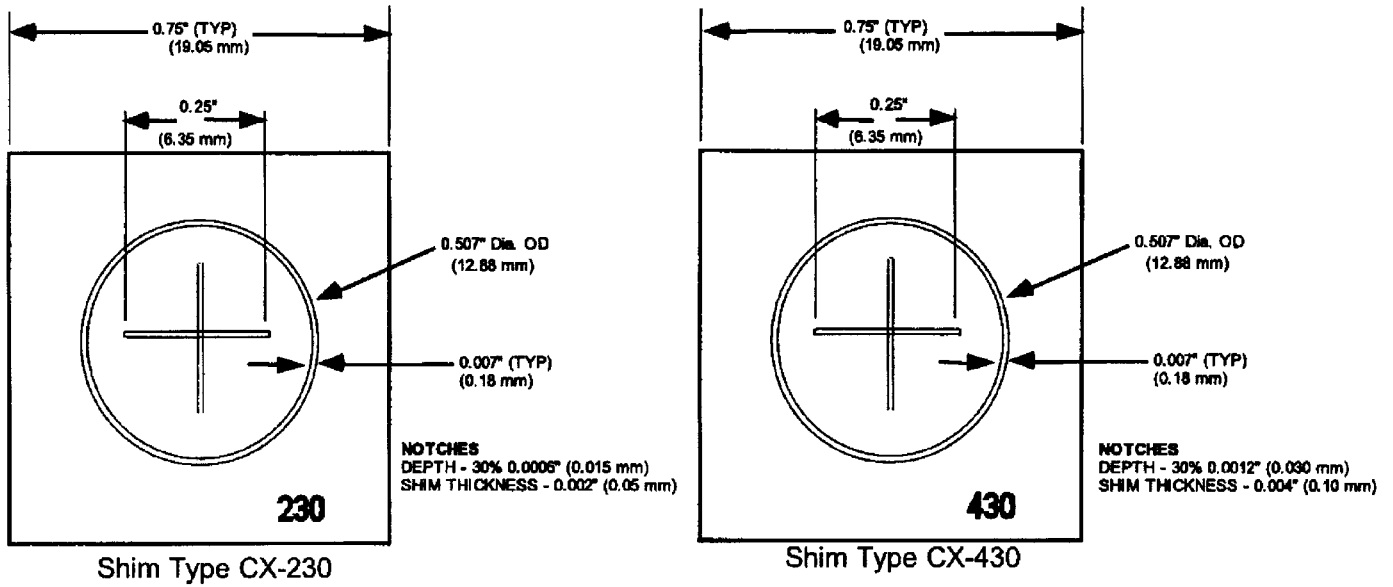


FIG. X2.1 Shims for Magnetic Particle Testing

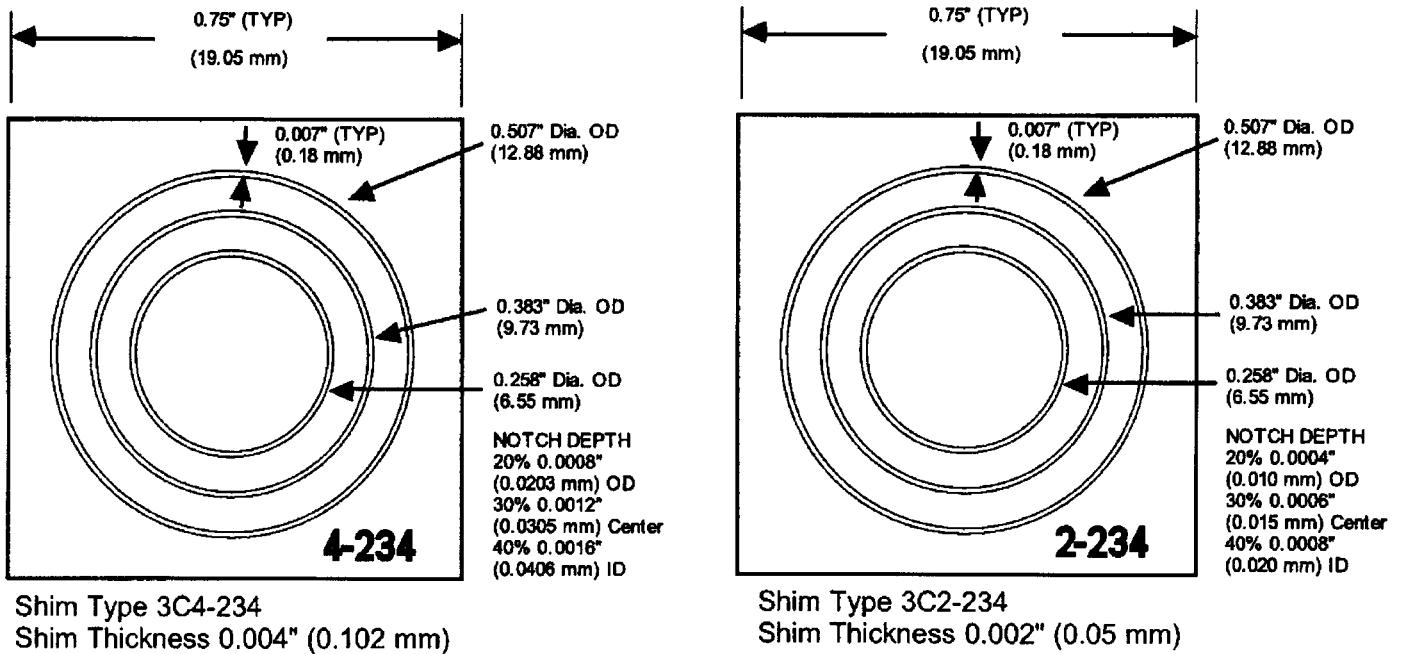


FIG. X2.2 Shims for Magnetic Particle Testing

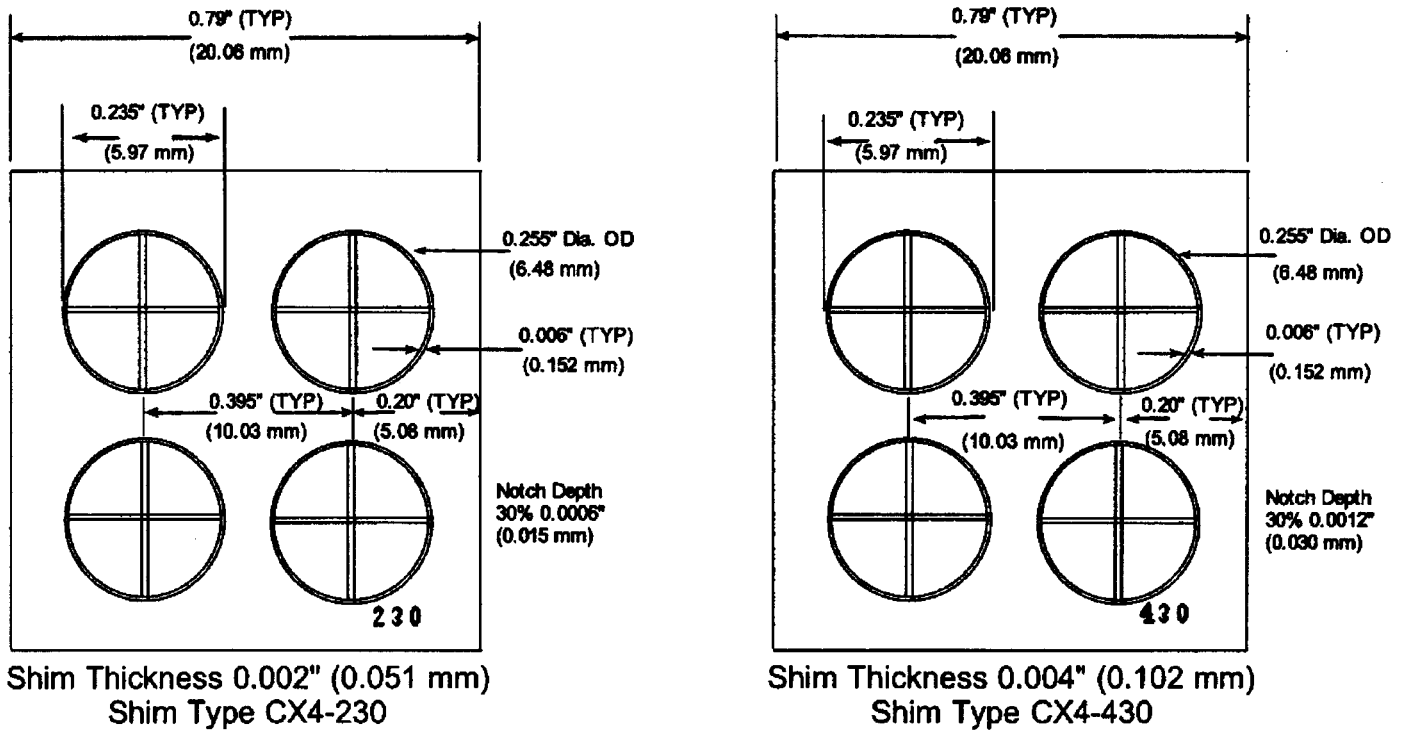


FIG. X2.3 Shims for Magnetic Particle Testing

X3. MEASUREMENT OF TANGENTIAL FIELD STRENGTH

X3.1 Care must be exercised when meas-

uring the tangential applied field strengths specified in 6.3.2. The active area of the Hall effect probe should be no larger than 0.2 in. (5.1 mm) by 0.2 in. (5.1 mm) and should have a maximum center location 5 mm from the part surface. The plane of the probe must be perpendicular to the surface of the part at the location of measurement to within 5 degrees. This is difficult to accomplish by hand orientation, therefore the probe should be held in a jig or fixture of some type. If the current is being applied in shots, or if alternating current or half-wave rectified alternating current is being used, the gaussmeter should be set to read the peak value during the shot. The gaussmeter should have a frequency response of 0 to 300 Hz or higher. The direction and magnitude of the tangential field on the part surface can be determined by two measurements made at right angles to each other at the same spot. The gaussmeter probe leads should be shielded or twisted to prevent reading errors due to voltage induced during the large field changes encountered during magnetic particle examination.

X4. FORMULAS FOR DETERMINING PROPER CURRENT VALUES FOR COILS

X4.1 The following formulas have been used for many years to develop techniques for examining parts using longitudinal fields produced by coils and cable wraps. Recent studies have indicated that the fields produced by these formulas may be excessive for some parts. They may be used as a guide to establish preliminary magnetizing current values and should be verified by one of the magnetic field strength monitoring methods referenced in 6.3.1.

X4.2 *Coil and Cable Wrap*—The following formulas hold only if the L/D is greater than 2 and less than 15. If L/D is less than 2, pole pieces (pieces of ferromagnetic material with the same diameter as the part being examined) may be placed on one or each end to effectively increase the L/D to 2 or greater. If the part has hollow portions, D may be replaced with D_{eff} as outlined in X4.2.4.

X4.2.1 *Longitudinal Magnetization with Low Fill Factor Coils*—When the cross-sectional area of the coil is ten or more times the cross-sectional area of part being examined, the following formulae apply:

X4.2.1.1 For parts positioned to the side of the coil:

$$NI = \frac{K}{L/D} (\pm 10\%) \quad (X4.1)$$

where:

- N = the number of turns in the coil,
- I = the current in amperes applied to the coil,
- K = 45 000 A turns,
- L = length of the part, and
- D = the diameter of the part (measured in the same units as the length).

(2) For

X4.2.1.2 For parts positioned in the center of the coil:

$$NI = \frac{KR}{(6L/D) - 5} (\pm 10\%) \quad (X4.2)$$

L

where:

- N = the number of turns in the coil,
- I = the current in amperes applied to the coil,
- R = radius of the coil, mm (or in.),
- K = 43 000 A turns per inch 1 690 if R is measured in inches (1690 A turns per mm); mm (43 000 if R is in inches),
- L = length of the part, and
- D = the diameter of the part (measured in the same units as the length).

If the part has hollow portions, replace D with D_{eff} as given in 6.3.7.4. These formulas hold only if L/D is greater than 2 and less than 15. If L/D is less than 2, pole pieces (pieces of ferromagnetic material with the same diameter as the part being tested) shall be placed on each end of the part to effectively increase the L/D to 2 or greater. If the L/D is greater than 15, the value of 15 shall be substituted for L/D .

6.3.7.2 Longitudinal

X4.2.2 Longitudinal Magnetization with Cable Wrap or High-Fill Factor Coils—When the cross-sectional area of the coil is less than twice the cross-sectional area (including hollow portions) of the part under testing, examination, the product of the number of coils turns, N , and the current in amperes through the coil, I , shall be as follows: following formula applies:

$$NI = \frac{K\{I\}}{(L/D) + 2 (\pm 10\%)} \quad (X4.3)$$

$$NI = \frac{K}{[(L/D) + 2]} (\pm 10\%) \quad (X4.3)$$

where:

- N = the number of turns in the coil,
- I = the current in amperes applied to the coil,
- K = 35 000 A turns,
- L = the length of the part,
- D = the diameter of the part (measured in the same units as the length).

If the part has hollow portions, replace D with D_{eff} as given in 6.3.7.4. These formulas hold only if L/D is greater than 2 and less than 15. If L/D is less than 2, pole pieces (pieces of ferromagnetic material with the same diameter as the part being tested) shall be placed on each end of the part to effectively increase the L/D to 2 or greater. If the L/D is greater than 15, the value of 15 shall be substituted for L/D .

6.3.7.3 Longitudinal

X4.2.3 Longitudinal Magnetization for Intermediate-Fill Factor Coils—When the cross-sectional area of the coil is between two 2 and ten 10 times the cross-sectional area of the part being inspected, examined, the product of the number of turns, N , and the current through the coil, I , shall be as follows: following formula applies:

$$NI = (NI)_h (10 - \tau)/8 + (NI)_l (\tau - 2)/8 \quad (X4.4)$$

$$NI = (NI)_h \left[\frac{10 - \tau}{8} \right] + (NI)_l \left[\frac{\tau - 2}{8} \right] \quad (X4.4)$$

I

where:

- N = the number of turns in the coil,
- I = the current in amperes applied to the coil,
- $(NI)_l$ = value of NI calculated for low-fill factor coils using 6.3.7.1, X4.2.1.1 or X4.2.1.2,
- $(NI)_h$ = value of NI calculated for high-fill factor coils using 6.3.7.2, X4.2.2, and

τ = the ratio of the cross-sectional area of the coil to the cross-sectional area of the part (f. For example, if the coil is 10 in. in diameter and the part is a rod 5 in. in diameter, $\tau = (\pi \times 5^2) / (\pi \times 2.5^2) = 4$). then:

$$\tau = \frac{(\pi \cdot 5^2)}{(\pi \cdot 2.5^2)} = 4 \quad (\text{X4.5})$$

~~6X4.32.7.4 Calculating the L/D Ratio for a Hollow or Cylindrical Part—When Partially Hollow Part—When calculating the L/D ratio for a hollow or cylindrical partially hollow part, D shall D may be replaced with an effective diameter, D_{eff} , calculated using diameter D_{eff} the following formulae:~~

$$D_{\text{eff}} = 2 \left[\sqrt{\frac{(A_t - A_h)}{\pi}} \right]^{1/2} \quad (\text{X4.6})$$

$$D_{\text{eff}} = \sqrt{\frac{(A_t - A_h)}{\pi}} \quad (\text{X4.6})$$

where:

A_t = the total cross-sectional area of the part, and

A_h = the total cross-sectional area of the hollow portions sections of the part.

For hollow cylindrical parts; this is equal to the following:

$$D_{\text{eff}} = \left[\sqrt{(OD)^2 - (ID)^2} \right]^{1/2} \quad (\text{X4.7})$$

$$D_{\text{eff}} = \sqrt{[(OD)^2 - (ID)^2]} \quad (\text{X4.7})$$

where:

OD = the outside diameter of the cylinder, and

ID = the inside diameter of the cylinder.

6.4 Particle Application:

6.4.1 *Continuous Method*—In the dry continuous method, magnetic particles

X5. SUITABILITY OF MATERIALS FOR MAGNETIC PARTICLE EXAMINATION

~~X5.1 Some materials are applied to the part while the magnetizing force is present. In the wet continuous method, the magnetizing current, or force, shall be applied simultaneously with or immediately after diverting the suspension. Application of the far more suitable for magnetic particles (see 6.4.4 and 6.4.5) and the magnetization method shall be as prescribed in the paragraphs referenced herein.~~

~~6.4.2 Residual Magnetization Method—particle examination than others. In the residual magnetization method, the magnetic particles are applied to the test part immediately after the magnetizing force has been discontinued. The residual method is not as sensitive as the continuous method, but it can some cases, penetrant inspection may be useful, for example, in detecting in-service induced fatigue cracks on the surface of material with a high retentivity. It is also useful for the more reliable examination method.~~

~~X5.2 Some of parts in areas in which, because of geometric constraints, the continuous method cannot be used. The residual method shall be used only when specifically approved by the contracting agency or when it has been documented that it can detect defects or artificial defects in test parts. The test parts shall have the same material and processing steps, and similar geometry to, the actual parts being inspected.~~

~~6.4.3 Prolonged Magnetization—When using polymers, slurries, or paints, prolonged or repeated periods of magnetization precipitation hardening (PH) steels are necessary because of lower magnetic particle mobility austenitic in the high-viscosity vehicles.~~

~~6.4.4 Dry Magnetic Particle Application—When using dry particles, the flow of magnetizing current shall be initiated prior to application of the magnetic particles to the surface under testing and terminated after powder application has been completed and any excess blown off. The duration of the magnetizing current shall be at least 1/2 s, and precaution shall be taken to prevent any damage of the part due to overheating annealed or other causes. Dry powder shall low heat treat ranges. Austenitic materials cannot be applied in a manner such that a light, uniform, dust-like coating settles on the surface of the test part while the part is being magnetized. Specially designed powder blowers or shakers using compressed air or hand power shall be used. The applicators shall introduce the particles into the air in a manner such that they reach the part surface in a uniform cloud with a minimum of force. After the powder is applied, and before the magnetizing force is removed, excess powder shall be removed examined by means of a dry air current with sufficient force to remove the excess particles, but not strong enough to disturb particles held by a leakage field that is indicative of discontinuities. In order to recognize the broad, fuzzy, lightly held powder patterns formed by near-surface discontinuities, the formation of indications must be observed carefully during both powder application and removal of the excess powder. Sufficient time for the formation and examination of indications shall be permitted during the testing process. The dry~~

particle method shall not be used to inspect aerospace components (flight hardware) without specific approval of the contracting agency:

6.4.5 Wet Magnetic Particle Application—Fluorescent or nonfluorescent particles suspended in a liquid vehicle at the required concentration shall be applied either by gently spraying or flowing the suspension over the area to be inspected. Proper sequencing and timing of part magnetization and application of particle suspension are required to obtain the proper formation and retention of indications. This generally requires that the stream of suspension be diverted from the part simultaneously with, or slightly before, energizing the magnetic circuit. The magnetizing current shall be applied for a duration of at least $\frac{1}{2}$ s for each application, with a minimum of two shots being used. The second shot should follow the first in rapid succession. It should come after the flow of suspension has been interrupted and before the part is examined for indications. Under special circumstances, such as the use of automated equipment or for critical parts, the $\frac{1}{2}$ -s duration and the two-shot requirement may be waived provided it is demonstrated that the test procedure given in 5.4 can detect known defects in representative test parts. particle method.

X5.3 Care shall be exercised to prevent any damage to the part due to overheating or other causes. Weakly held indications on highly finished parts are readily washed away, and hence care must be exercised to prevent high-velocity flow over critical surfaces:

6.4.6 Magnetic Slurry/Paint Application—Magnetic paints or slurries are applied to the part taken with a brush, squeeze bottle, or aerosol can before or during the magnetization operation. This method is for special applications, low permeability steels, such as overhead or underwater examination. This method shall be used only when specifically approved by the contracting agency.

6.4.7 Magnetic Polymer Application—Polymerizable material containing magnetic particles shall be held in contact with the test part during the period of its cure. Before curing takes place, and while the magnetic particles are still mobile, the part shall be magnetized PH steels, to the specified level. This requires prolonged or repeated periods of magnetization. This method is for special applications, such as bolt holes, which cannot be tested readily by the wet or dry method, and shall be used only when specifically approved by the contracting agency. MIL-I-83387 establishes the inspection process for magnetic rubber.

6.5 Evaluation—Following magnetization and particle application, the parts shall be examined for indications. All indications will be identified as relevant or nonrelevant. Relevant indications will be compared to accept/reject criteria and the parts accepted or rejected accordingly.

6.6 Recording of Indications—When required by the written procedure, the location of all rejectable indications shall be marked on the part, and permanent records of the location, direction, and frequency of indications may be made by one or more of the following methods:

6.6.1 Written Description—By recording the location, length, direction, and number of indications in sketch or tabular form.

6.6.2 Transparent Tape—For dry particle indications, by applying transparent adhesive-backed tape to which the indications will adhere and placing it on an approved form along with information giving its location on the part.

6.6.3 Strippable Film—By covering the indication with use a spray-on strippable film that fixes the indications in place and placing the resultant reproduction on an approved form along with information giving its location on the part.

6.6.4 Photography—By photographing or video recording the indications themselves, the tape, or the strippable film reproduction and placing the photograph in a tabular form along with information giving its location on the part.

6.7 Postinspection Demagnetization and Cleaning—Unless directed otherwise by the contracting agency, all parts shall be demagnetized, cleaned, and corrosion protected after examination:

6.7.1 Demagnetization:

6.7.1.1 When using ac demagnetization, the part shall be subjected high enough amperage to a provide proper field strength.

X5.4 Steels with a peak value greater than, and in nearly the same direction as, the field used during examination. This ac field is then decreased gradually to zero. When using an ac demagnetizing coil, hold the part approximately 1 ft (30 cm) in front of the coil and then move it slowly and steadily through the coil and at least 3 ft (100 cm) beyond the end of the coil. Repeat this process as necessary. Rotate and tumble parts of complex configuration while passing through the field of the coil.

6.7.1.2 When using dc demagnetization, the initial field shall be higher than, and in nearly the same direction as, the field reached during examination. The field shall then be reversed, decreased in magnitude, and the process repeated (cycled) until an acceptably low value of residual field is reached.

6.7.1.3 Whenever possible, parts that have been very high permeability are easily magnetized circularly shall be magnetized in the longitudinal direction before being demagnetized. After demagnetization, a magnetic field probe or strength meter shall but should not detect fields with an absolute value above 3 G (240 Am^{-1}) anywhere on the part.

6.7.2 Postinspection Cleaning—Cleaning shall be done examined with a suitable solvent, air blower, or by other means. Parts shall be inspected to ensure that the cleaning procedure has removed magnetic particle residues from coolant holes, crevices, passage ways, etc., since such residue could have an adverse effect on the intended use of the part. Care shall be taken to remove all plugs, masking, or other processing aids that may affect the intended use of the part. Parts shall be protected from any possible corrosion or damage during the cleaning process and shall be treated to prevent the occurrence of corrosion after final inspection.

7. Quality Control

7.1 System Performance:

tube (of the size stainless and shape specified in Test Methods D 96, except graduated to 1 mL in 0.05-mL increments). Demagnetize the sample corrosion resistant steels and allow the tube to stand undisturbed their suitability for at least 60 min if using the petroleum distillate in AMS 2641 or 30 min settling time for conditioned water suspension. Read the volume of settled particles. If the concentration is out of the tolerance stated in the written procedure (or that given in 5.8.5), add the particles or suspension vehicle, as required, and redetermine the particle concentration. If the settled particles appear to be loose agglomerates rather than a solid layer, take a second sample. If the second sample also appears agglomerated, replace the entire suspension. Thirty-minute settling times, or other accelerated tests, may be used if they have been verified to give results equivalent to the procedure described in this paragraph.

(2) *Determination of Wet Particle Contamination*—Perform the tests specified in 7.1.4.1 (1). In addition, for fluorescent baths, examine the liquid above the precipitate examination with black light. The liquid shall be comparable to the fluorescence of the original solution. Examine the graduated portion of the tube, under both black light (for fluorescent baths only) and visible light (for both fluorescent and nonfluorescent baths), for striations or bands, different in color or appearance. Bands or striations may indicate contamination. If the total volume of the contaminants, including bands or striations, exceeds 30 % of the volume of magnetic particles, or if the liquid is noticeably fluorescent, the bath must be replaced.

7.1.4.2 *Water Break Test*—In this test of water-based vehicles, a clean part with a surface finish the same as the parts to be tested is flooded with the conditioned water, and the appearance of the surface is noted after flooding is stopped. If a continuous even film forms over the entire part, sufficient wetting agent is present. If the film of suspension breaks, exposing bare surface, insufficient wetting agent is present or the part has not been cleaned adequately.

7.1.5 *Equipment Calibration*—Magnetic particle testing equipment shall be checked for performance method.

X5.6 Aluminum and accuracy at the time of purchase aluminum based alloys, copper and at intervals thereafter as given in Table 1, whenever malfunction is suspected or when specified by the contracting agency, copper based alloys, and whenever electrical maintenance that might affect equipment accuracy is performed.

7.1.5.1 *Ammeter Accuracy*—To check the equipment ammeter, a calibrated ammeter shall nickel based alloys cannot be connected in series with the output circuit. Comparative readings shall be taken at three output levels encompassing the useable range of the equipment. The equipment meter reading shall not deviate examined by more than $\pm 10\%$ of full scale from the current value shown by the calibrated ammeter. (When measuring half-wave alternating current, the current values shown by the calibrated de ammeter readings shall be doubled.) The frequency of the ammeter check is specified in Table 1.

7.1.5.2 *Timer Control Check*—On equipment using a timer to control the current duration, the timer should be checked to within ± 0.1 s using a suitable electronic timer.

7.1.5.3 *Magnetic Field Quick Break Check*—On equipment that uses a quick break feature, proper functioning of this circuit shall be verified. The test may be performed using a suitable oscilloscope or other applicable method as specified by the equipment manufacturer.

7.1.5.4 *Dead Weight Check*—Yokes and permanent magnetics (when allowed) shall be dead weight tested at intervals as stated in Table 1. Alternating current yokes shall have a lifting force of at least 10 lb (45 N), with a 2 to 4-in. (50 to 100-mm) spacing between legs. Direct current yokes shall have a lifting force of at least 30 lb (135 N), with a 2 to 4-in. (50 to 100-mm) spacing between legs, or 50 lb (225 N), with a 4 to 6-in. (100 to 150-mm) spacing.

7.2 *Marking of Inspected Parts*—Unless otherwise specified by the contracting agency, parts that have been accepted using magnetic particle examination shall be marked in accordance with the applicable drawing, purchase order, contract, or as specified herein. Marking shall be applied in such a manner method.

X5.7 All low-alloy carbon steels, 1000 series (1020, 1050, 1117, 1340 etc.), 4000 series (4130, 4330 4340M, etc.), 5000, 6000, 8000, 9000 series, HY 80, HY 100, 9Ni-4Co, and location as to be harmless to the part. The identification shall not be obliterated or smeared by subsequent handling and, when practicable, placed in a location that will be visible after assembly. When subsequent processing would remove the identification, the applicable marking shall be affixed to the record accompanying the finished parts or assembly. Bolts and nuts and other fastener products may be identified as having met the requirements of magnetic particle examination by marking each package conspicuously.

7.2.1 *Impression Stamping, Ink Stamping, Laser Marking, or Vibro Engraving*—Impression stamping, ink stamping, laser marking, or vibro engraving shall be used when permitted or required by the applicable written procedure, detail specification or drawing, or when the nature of the part is such as to provide for impression stamping of part numbers or other inspector's markings. Impression stamping shall be located only in the area provided adjacent to the part number or inspector's stamp unless otherwise specified by the contracting agency.

7.2.2 *Etching*—When impression stamping, ink stamping, laser marking, or vibro engraving is prohibited, parts shall be etched using an etching fluid or other means Maraging steels are ferro-magnetic and a method of application acceptable to the contracting agency. The etching process and location shall not affect the functioning of the part adversely.

7.2.3 *Dyeing*—When stamping, vibro engraving, or etching is not permissible, identification shall can be accomplished by dyeing.

7.2.4 *Other Identification*—Other means of identification, such as tagging, shall be used for parts that have a construction or

function precluding the use of stamping, vibro engraving, or etching, as in the case of completely ground or polished balls, rollers, pins, or bushings:

7.2.5 Identifying Symbols and Color Markings:

7.2.5.1 One-Hundred Percent Examination—When items are examined and accepted by 100 % examination, each item shall be marked as follows:

(1) *Dyeing*—When dyeing is applicable, a dye of acceptable adherence which is predominantly blue (per FED-STD-595) shall be employed. However, if a color conflict is incurred with any other method, magnetic particle examination can be indicated by two adjacent blue dots or other suitable means:

(2) *Stamping, Laser Marking, Vibro Engraving, or Etching*—When impression stamping or ink stamping, laser marking, vibro engraving, or etching is used to mark 100 % inspected parts, the letter “M” with a circle around it will be employed:

7.2.5.2 Lot Inspection—When items are accepted by means of a sampling procedure, each item of an accepted lot shall be marked as follows:

(1) *Dyeing*—When dyeing is applicable, a dye of acceptable adherence that is predominantly orange (per FED-STD-595) shall be employed:

(2) *Stamping, Vibro Engraving, or Etching*—When impression stamping, vibro engraving or etching is used to mark lot inspected parts, the letter “M” shall be employed:

7.3 Eye Glasses—When using fluorescent materials, inspectors shall not wear eye glasses that are photochromic or that have permanently darkened lenses. This is not intended to prohibit the use of eyeglasses with lenses treated to absorb ultraviolet light.

7.4 Safety—The safe handling of magnetic particles (wet or dry), oil vehicles water baths, and water conditioner concentrates are governed by the suppliers’ Material Safety Data Sheets (MSDS). Material Safety Data Sheets, conforming to 29 CFR 1910.1200, or equivalent, must be provided by the supplier to any user and shall be prepared in accordance with FED-STD-313:

7.4.1 Flammability—Flash point of oil vehicles shall be in accordance with AMS 2641 or DoD-F-87935. The suppliers’ MSDS shall certify the flash point.

7.4.2 Personnel Hazards—Precautions against inhalation, skin contact, and eye exposure are detailed in the suppliers’ MSDS. These precautions shall be observed.

7.4.3 Electrical Hazards—Magnetizing equipment shall be maintained properly to prevent personnel hazards from electrical short circuits. Care must be taken to reduce arcing and the possible ignition of oil baths.

7.4.4 Black Light—It is recommended that the intensity of black light incident on unprotected skin or eyes not exceed 1000 $\mu\text{W}/\text{cm}^2$. Cracked or broken ultraviolet filters shall be replaced immediately. Broken bulbs can continue to radiate ultraviolet energy and must be replaced immediately. Spectacles designed to absorb ultraviolet wavelength radiation are suggested for close, high, black light intensity examination.

7.5 Dark Adaptation—Personnel must wait at least 1 min after entering a darkened area for their eyes to adjust to the low-level lighting before performing fluorescent magnetic particle examination.

8. Keywords

8.1 dye; fluorescent; magnetic particle; nondestructive evaluation; nondestructive examination; nondestructive testing method.

APPENDIX

(Nonmandatory Information)

X1. MEASUREMENT OF TANGENTIAL FIELD STRENGTH

X1.1—Care must be exercised when measuring the tangential applied field strengths specified in 6.3.2. The active area of the Hall effect probe should be no larger than 0.2 in. (5 mm) by 0.2 in. (5 mm) and should have a maximum center location 5 mm from the part surface. The plane of the probe must be perpendicular to the surface of the part at the location of measurement to within 5 degrees. This is difficult to accomplish by hand orientation, therefore the probe should be held in a jig or fixture of some type. If the current is being applied in shots, or if alternating current or half-wave rectified alternating current is being used, the gaussmeter should be set to read the peak value during the shot. The gaussmeter should have a frequency response of 0 to 300 Hz or higher. The direction and magnitude of the tangential field on the part surface can be determined by two measurements made at right angles to each other at the same spot. The gaussmeter probe leads should be shielded or twisted to prevent reading errors due to voltage induced during the large field changes encountered during magnetic particle examination.

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org).