



Designation: E 1921 – 02³

Standard Test Method for Determination of Reference Temperature, T_o , for Ferritic Steels in the Transition Range¹

This standard is issued under the fixed designation E 1921; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This test method covers the determination of a reference temperature, T_o , which characterizes the fracture toughness of ferritic steels that experience onset of cleavage cracking at elastic, or elastic-plastic K_{Jc} instabilities, or both. The specific types of ferritic steels (3.2.1) covered are those with yield strengths ranging from 275 to 825 MPa (40 to 120 ksi) and weld metals, after stress-relief annealing, that have 10 % or less strength mismatch relative to that of the base metal.

1.2 The specimens covered are fatigue precracked single-edge notched bend bars, SE(B), and standard or disk-shaped compact tension specimens, C(T) or DC(T). A range of specimen sizes with proportional dimensions is recommended. The dimension on which the proportionality is based is specimen thickness.

~~1.3 Requirements are set on specimen size and the number of replicate tests that are needed to establish acceptable characterization of~~

~~1.3 Median K_{Jc} data populations.~~

~~1.4 The statistical effects of values tend to vary with the specimen type at a given test temperature, presumably due to constraint differences among the allowable test specimens in 1.2. The degree of K_{Jc} variability among specimen types is~~

¹ This test method is under the jurisdiction of ASTM Committee E08 on Fatigue and Fracture and is the direct responsibility of E08.08 on Elastic-Plastic Fracture Mechanics Technology.

Current edition approved ~~March 10, 2002~~; Nov. 1, 2003. Published ~~June 2002~~; December 2003. Originally published as E 1921 – 97; approved in 1997. Last previous edition ~~E 1921 – 97¹~~; approved in 2002 as E 1921 – 02.

analytically predicted to be a function of the transition range are treated using weakest-link theory material flow properties (1)² and decreases with increasing strain hardening capacity for a given yield strength material. This K_{Jc} dependency ultimately leads to discrepancies in calculated T_o values as a function of specimen type for the same material. T_o values obtained from C(T) specimens are expected to be higher than T_o values obtained from SE(B) specimens. Best estimate comparisons of several materials indicate that the average difference between C(T) and SE(B)-derived T_o values is approximately 10°C (2). C(T) and SE(B) T_o differences up to 15°C have also been recorded (3). However, comparisons of individual, small datasets may not necessarily reveal this average trend. Datasets which contain both C(T) and SE(B) specimens may generate T_o results which fall between the T_o values calculated using solely C(T) or SE(B) specimens. It is therefore strongly recommended that the specimen type be reported along with the derived T_o value in all reporting, analysis, and discussion of results. This recommended reporting is in addition to the requirements in 11.1.1.

1.4 Requirements are set on specimen size and the number of replicate tests that are needed to establish acceptable characterization of K_{Jc} data populations.

1.5 The statistical effects of specimen size on K_{Jc} in the transition range are treated using weakest-link theory (4) applied to a three-parameter Weibull distribution of fracture toughness values. A limit on K_{Jc} values, relative to the specimen size, is specified to ensure high constraint conditions along the crack front at fracture. For some materials, particularly those with low strain hardening, this limit may not be sufficient to ensure that a single-parameter (K_{Jc}) adequately describes the crack-front deformation state (2)(5).

1.56 Statistical methods are employed to predict the transition toughness curve and specified tolerance bounds for 1T specimens of the material tested. The standard deviation of the data distribution is a function of Weibull slope and median K_{Jc} . The procedure for applying this information to the establishment of transition temperature shift determinations and the establishment of tolerance limits is prescribed.

1.67 The fracture toughness evaluation of nonuniform material is not amenable to the statistical analysis methods employed in this standard. Materials must have macroscopically uniform tensile and toughness properties. For example, multipass weldments can create heat-affected and brittle zones with localized properties that are quite different from either the bulk material or weld. Thick section steel also often exhibits some variation in properties near the surfaces. Metallography and initial screening may be necessary to verify the applicability of these and similarly graded materials. Particular notice should be given to the 2% and 98% tolerance bounds on K_{Jc} presented in 9.3. Data falling outside these bounds may indicate nonuniform material properties.

1.78 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 ASTM Standards:³

E 4 Practices for Force Verification of Testing Machines

E 8M Test Methods for Tension Testing of Metallic Materials (Metric)

E 23 Test Methods for Notched Bar Impact Testing of Metallic Materials

E 74 Practice for Calibration of Force Measuring Instruments for Verifying the Force Indication of Testing Machines

E 208 Test Method for Conducting Drop-Weight Test to Determine Nil-Ductility Transition Temperature of Ferritic Steels

E 399 Test Method for Plane-Strain Fracture Toughness of Metallic Materials

E 436 Test Method for Drop-Weight Tear Tests of Ferritic Steels

E 561 Practice for R-Curve Determination

E 812 Test Method for Crack Strength of Slow-Bend, Precracked Charpy Specimens of High-Strength Metallic Materials

E 1820 Test Method for Measurement of Fracture Toughness

E 1823 Terminology Relating to Fatigue and Fracture Testing

3. Terminology

3.1 Terminology given in Terminology E 1823 is applicable to this test method.

3.2 Definitions:

3.2.1 *ferritic steels*— are typically carbon, low-alloy, and higher alloy grades. Typical microstructures are bainite, tempered bainite, tempered martensite, and ferrite and pearlite. All ferritic steels have body centered cubic crystal structures that display ductile-to-cleavage transition temperature fracture toughness characteristics. See also Test Methods E 23, E 208 and E 436.

NOTE 1—This definition is not intended to imply that all of the many possible types of ferritic steels have been verified as being amenable to analysis by this test method.

3.2.2 *stress-intensity factor, $K[FL^{-3/2}]$* —the magnitude of the mathematically ideal crack-tip stress field coefficient (stress field singularity) for a particular mode of crack-tip region deformation in a homogeneous body.

² The boldface numbers in parentheses refer to the list of references at the end of this standard.

³ For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards*, Vol 03-04, volume information, refer to the standard's Document Summary page on the ASTM website.

3.2.3 *Discussion*—In this test method, Mode I is assumed. See Terminology E 1823 for further discussion.

3.2.4 *J-integral, $J[FL^{-1}]$* —a mathematical expression; a line or surface integral that encloses the crack front from one crack surface to the other; used to characterize the local stress-strain field around the crack front (36). See Terminology E 1823 for further discussion.

3.3 *Definitions of Terms Specific to This Standard:*

3.3.1 *control load, $P_M[F]$* —a calculated value of maximum load used in Test Method E 1820, Eqs. A1.1 and A2.1 to stipulate allowable precracking limits.

3.3.1.1 *Discussion*—In this method, P_M is not used for precracking, but is used as a minimum load above which partial unloading is started for crack growth measurement.

3.3.2 *crack initiation*—describes the onset of crack propagation from a preexisting macroscopic crack created in the specimen by a stipulated procedure.

3.3.3 *effective modulus, $E_e[FL^{-2}]$* —an elastic modulus that can be used with experimentally determined elastic compliance to effect an exact match to theoretical (modulus-normalized) compliance for the actual initial crack size, a_o .

3.3.4 *elastic modulus, $E'[FL^{-2}]$* —a linear-elastic factor relating stress to strain, the value of which is dependent on the degree of constraint. For plane stress, $E' = E$ is used, and for plane strain, $E/(1 - \nu^2)$ is used, with ν being Poisson's ratio.

3.3.5 *elastic-plastic $K_J[FL^{-3/2}]$* —An elastic-plastic equivalent stress intensity factor derived from *J-integral*.

3.3.5.1 *Discussion*—In this test method, K_J also implies a stress intensity factor determined at the test termination point under conditions determined to be invalid by 8.9.2.

3.3.6 *elastic-plastic $K_{Jc}[FL^{-3/2}]$* —an elastic-plastic equivalent stress intensity factor derived from the *J-integral* at the point of onset of cleavage fracture, J_c .

3.3.7 *Eta (η)*—a dimensionless parameter that relates plastic work done on a specimen to crack growth resistance defined in terms of deformation theory *J-integral* (47).

3.3.8 *failure probability, p_f* —the probability that a single selected specimen chosen at random from a population of specimens will fail at or before reaching the K_{Jc} value of interest.

3.3.9 *initial ligament length, $b_o[L]$* —the distance from the initial crack tip, a_o , to the back face of a specimen.

3.3.10 *pop-in*—a discontinuity in a load versus displacement test record (5)(8).

3.3.10.1 *Discussion*—A pop-in event is usually audible, and is a sudden cleavage crack initiation event followed by crack arrest. A test record will show increased displacement and drop in applied load if the test frame is stiff. Subsequently, the test record may continue on to higher loads and increased displacement.

3.3.11 *precracked charpy specimen*—SE(B) specimen with $W = B = 10$ mm (0.394 in.).

3.3.12 *reference temperature, T_o [°C]*—The test temperature at which the median of the K_{Jc} distribution from 1T size specimens will equal $100 \text{ MPa}\sqrt{\text{m}}$ ($91.0 \text{ ksi}\sqrt{\text{in.}}$).

3.3.13 *SE(B) specimen span, $S[L]$* —the distance between specimen supports (See Test Method E 1820 Fig. 3).

3.3.14 *specimen thickness, $B[L]$* —the distance between the sides of specimens.

3.3.14.1 *Discussion*—In the case of side-grooved specimens, thickness, B_N , is the distance between the roots of the side-groove notches.

3.3.15 *specimen size, nT* —a code used to define specimen dimensions, where n is expressed in multiples of 1 in.

3.3.15.1 *Discussion*—In this method, specimen proportionality is required. For compact specimens and bend bars, specimen thickness $B = n$ inches.

3.3.16 *temperature, T_Q [°C]*—For K_{Jc} values that are developed using specimens or test practices, or both, that do not conform to the requirements of this test method, a temperature at which $K_{Jc}(\text{med}) = 100 \text{ MPa}\sqrt{\text{m}}$ is defined as T_Q . T_Q is not a provisional value of T_o .

3.3.17 *Weibull fitting parameter, K_0* —a scale parameter located at the 63.2 % cumulative failure probability level (6)(9). $K_{Jc} = K_0$ when $p_f = 0.632$.

3.3.18 *Weibull slope, b* —with p_f and K_{Jc} data pairs plotted in linearized Weibull coordinates obtainable by rearranging Eq. 15, b is the slope of a line that defines the characteristics of the typical scatter of K_{Jc} data.

3.3.18.1 *Discussion*—A Weibull slope of 4 is used exclusively in this method.

3.3.19 *yield strength, $\sigma_{ys}[FL^{-2}]$* —a value of material strength at 0.2 % plastic strain as determined by tensile testing.

4. Summary of Test Method

4.1 This test method involves the testing of notched and fatigue precracked bend or compact specimens in a temperature range where either cleavage cracking or crack pop-in develop during the loading of specimens. Crack aspect ratio, a/W , is nominally 0.5. Specimen width in compact specimens is two times the thickness. In bend bars, specimen width can be either one or two times the thickness.

4.2 Load versus displacement across the notch at a specified location is recorded by autographic recorder or computer data acquisition, or both. Fracture toughness is calculated at a defined condition of crack instability. The *J-integral* value at instability, J_c , is calculated and converted into its equivalent in units of stress intensity factor, K_{Jc} . Validity limits are set on the suitability of data for statistical analyses.

4.3 Tests that are replicated at least six times can be used to estimate the median K_{Jc} of the Weibull distribution for the data

population (**710**). Extensive data scatter among replicate tests is expected. Statistical methods are used to characterize these data populations and to predict changes in data distributions with changed specimen size.

4.4 The statistical relationship between specimen size and K_{Jc} fracture toughness can be assessed using weakest-link theory, thereby providing a relationship between the specimen size and K_{Jc} (**4**). Limits are placed on the fracture toughness range over which this model can be used.

4.5 For definition of the toughness transition curve, a master curve concept is used (**8, 9**)(**11, 12**). The position of the curve on the temperature coordinate is established from the experimental determination of the temperature, designated T_o , at which the median K_{Jc} for 1T size specimens is 100 MPa \sqrt{m} (91.0 ksi $\sqrt{in.}$). Selection of a test temperature close to that at which the median K_{Jc} value will be 100 MPa \sqrt{m} is encouraged and a means of estimating this temperature is suggested. Small specimens such as precracked Charpys may have to be tested at temperatures below T_o where $K_{Jc(med)}$ is well below 100 MPa \sqrt{m} . In such cases, additional specimens may be required as stipulated in 8.5.

4.6 Tolerance bounds can be determined that define the range of scatter in fracture toughness throughout the transition range. The standard deviation of the fitted distribution is a function of Weibull slope and median K_{Jc} value, $K_{Jc(med)}$.

5. Significance and Use

5.1 Fracture toughness is expressed in terms of an elastic-plastic stress intensity factor, K_{Jc} , that is derived from the J -integral calculated at fracture.

5.2 Ferritic steels are inhomogeneous with respect to the orientation of individual grains. Also, grain boundaries have properties distinct from those of the grains. Both contain carbides or nonmetallic inclusions that can act as nucleation sites for cleavage microcracks. The random location of such nucleation sites with respect to the position of the crack front manifests itself as variability of the associated fracture toughness (**103**). This results in a distribution of fracture toughness values that is amenable to characterization using statistical methods.

5.3 Distributions of K_{Jc} data from replicate tests can be used to predict distributions of K_{Jc} for different specimen sizes. Theoretical reasoning (**69**), confirmed by experimental data, suggests that a fixed Weibull slope of 4 applies to all data distributions and, as a consequence, standard deviation on data scatter can be calculated. Data distribution and specimen size effects are characterized using a Weibull function that is coupled with weakest-link statistics (**114**). An upper limit on constraint loss and a lower limit on test temperature are defined between which weakest-link statistics can be used.

5.4 The experimental results can be used to define a master curve that describes the shape and location of median K_{Jc} transition temperature fracture toughness for 1T specimens (**125**). The curve is positioned on the abscissa (temperature coordinate) by an experimentally determined reference temperature, T_o . Shifts in reference temperature are a measure of transition temperature change caused, for example, by metallurgical damage mechanisms.

5.5 Tolerance bounds on K_{Jc} can be calculated based on theory and generic data. For added conservatism, an offset can be added to tolerance bounds to cover the uncertainty associated with estimating the reference temperature, T_o , from a relatively small data set. From this it is possible to apply a margin adjustment to T_o in the form of a reference temperature shift.

5.6 For some materials, particularly those with low strain hardening, the value of T_o may be influenced by specimen size due to a partial loss of crack-tip constraint (**25**). When this occurs, the value of T_o may be lower than the value that would be obtained from a data set of K_{Jc} values derived using larger specimens.

6. Apparatus

6.1 *Precision of Instrumentation*—Measurements of applied loads and load-line displacements are needed to obtain work done on the specimen. Load versus load-line displacements may be recorded digitally on computers or autographically on x - y plotters. For computers, digital signal resolution should be 1/32,000 of the displacement transducer signal range and 1/4000 of the load transducer signal range.

6.2 *Grips for C(T) Specimens*—A clevis with flat-bottom holes is recommended. See Test Method E 399-90, Fig. A6.2, for a recommended design. Clevises and pins should be fabricated from steels of sufficient strength to elastically resist indentation loads (greater than 40 Rockwell hardness C scale (HRC)).

6.3 *Bend Test Fixture*—A suitable bend test fixture scheme is shown in Fig. A3.2 of Test Method E 399-90. It allows for roller pin rotation and minimizes friction effects during the test. Fixturing and rolls should be made of high-hardness steel (HRC greater than 40).

6.4 *Displacement Gage for Compact Specimens:*

6.4.1 Displacement measurements are made so that J values can be determined from area under load versus displacement test records (a measure of work done). If the test temperature selection recommendations of this practice are followed, crack growth measurement will probably prove to be unimportant. Results that fall within the limits of uncertainty of the recommended test temperature estimation scheme will probably not have significant slow-stable crack growth prior to instability. Nevertheless, crack growth measurements are recommended to provide supplementary information, and these results may be reported.

6.4.2 Unloading compliance is the primary recommendation for measuring slow-stable crack growth. See Test Method E 1820. When multiple tests are performed sequentially at low test temperatures, there will be condensation and ice buildup on the grips between the loading pins and flats of the clevis holes. Ice will interfere with the accuracy of the unloading compliance method. Alternatively, crack growth can be measured by other methods such as electric potential, but care must be taken to avoid specimen

heating when low test temperatures are used.

6.4.3 In compact C(T) specimens, displacement measurements on the load line are recommended for J determinations. However, the front face position at $0.25W$ in front of the load line can be used with interpolation to load-line displacement, as suggested in 7.1.

6.4.4 The extensometer calibrator shall be resettable at each displacement interval within 0.0051 mm (0.0002 in.). Accuracy of the clip gage at test temperature must be demonstrated to be within 1 % of the working range of the gage.

6.4.5 All clip gages used shall have temperature compensation.

6.5 *Displacement Gages for Bend Bars, SE(B):*

6.5.1 The SE(B) specimen has two displacement gage locations. A load-line displacement transducer is primarily intended for J computation, but may also be used for calculations of crack size based on elastic compliance, if provision is made to subtract the extra displacement due to the elastic compliance of the fixturing. The load-line gage shall display accuracy of 1 % over the working range of the gage. The gages used shall not be temperature sensitive.

6.5.2 Alternatively, a crack-mouth opening displacement (CMOD) gage can also be used to determine the plastic part of J . However, it is necessary to employ a plastic eta (η_p) value developed specifically for that position (136) or to infer load-point displacement from mouth opening using an expression that relates the two displacements (147). In either case, the procedure described in 9.1.4 is used to calculate the plastic part of J . The CMOD position is the most accurate for the compliance method of slow-stable crack growth measurement.

6.5.3 Crack growth can be measured by alternative methods such as electric potential, but care must be taken to minimize specimen heating effects in low-temperature tests (see also 6.4.2) (158).

6.6 *Force Measurement:*

6.6.1 Testing shall be performed in a machine conforming to Practices of E 4-93 and E 8M-95. Applied force may be measured by any transducer with a noise-to-signal ratio less than 1/2000 of the transducer signal range.

6.6.2 Calibrate force measurement instruments by way of Practice E 74-91, 10.2. Annual calibration using calibration equipment traceable to the National Institute of Standards and Technology is a mandatory requirement.

6.7 *Temperature Control*—Specimen temperature shall be measured with thermocouple wires and potentiometers. It is recommended that the two thermocouple wires be attached to the specimen surface separately, either by welding, spot welding, or by being affixed mechanically. Mechanical attachment schemes must be verified to provide equivalent temperature measurement accuracy. The purpose is to use the test material as a part of the thermocouple circuit (see also 8.6.1). Accuracy of temperature measurement shall be within 3°C of true temperature and repeatability among specimens shall be within 2°C. Precision of measurement shall be $\pm 1^\circ\text{C}$ or better. The temperature measuring apparatus shall be checked every six months using instruments traceable to the National Institute of Standards and Technology in order to ensure the required accuracy.

7. Specimen Configuration, Dimensions, and Preparation

7.1 *Compact Specimens*—Three recommended C(T) specimen designs are shown in Fig. 1. One C(T) specimen configuration is taken from Test Method E 399-90; the two with cutout sections are taken from E 1820. The latter two designs are modified to permit load-line displacement measurement. Room is provided for attachment of razor blade tips on the load line. Care should be taken to maintain parallel alignment of the blade edges. When front face (at $0.25W$ in front of the load line) displacement measurements are made with the Test Method E 399 design, the load-line displacement can be inferred by multiplying the measured values by the constant 0.73 (169). The ratio of specimen height to width, $2H/W$ is 1.2, and this ratio is to be the same for all types and sizes of C(T) specimens. The initial crack size, a_o , shall be $0.5W \pm 0.05W$. Specimen width, W , shall be 2B.

7.2 *Disk-shaped Compact Specimens*—A recommended DC(T) specimen design is shown in Fig. 2. Initial crack size, a_o , shall be $0.5W \pm 0.05W$. Specimen width shall be 2B.

7.3 *Single-edge Notched Bend*—The recommended SE(B) specimen designs, shown in Fig. 3, are made for use with a span-to-width ratio, $S/W = 4$. The width, W , can be either 1B or 2B. The initial crack size, a_o , shall be $0.5W \pm 0.05W$.

7.4 *Machined Notch Design*—The machined notch plus fatigue crack for all specimens shall lie within the envelope shown in Fig. 4.

7.5 *Specimen Dimension Requirements*—The crack front straightness criterion defined in 8.9.1 must be satisfied. The specimen remaining ligament, b_o , must have sufficient size to maintain a condition of high crack-front constraint at fracture. The maximum K_{Jc} capacity of a specimen is given by:



$$K_{Jc \text{ (limit)}} = \sqrt{\frac{Eb_o\sigma_{ys}}{30(1 - \nu^2)}} \quad (1)$$

where:


σ_{ys} = material yield strength at the test temperature.

K_{Jc} data that exceed this requirement may be used in a data censoring procedure. Details of this procedure are described in section 10.2.2 for single-temperature data and 10.4.2 for multi-temperature data.

7.6 *Small Specimens*—At high values of fracture toughness relative to specimen size and material flow properties, the values of K_{Jc} that meet the requirements of Eq 1 may not always provide a unique description of the crack-front stress-strain fields due to some loss of constraint caused by excessive plastic flow (25). This condition may develop in materials with low strain hardening.

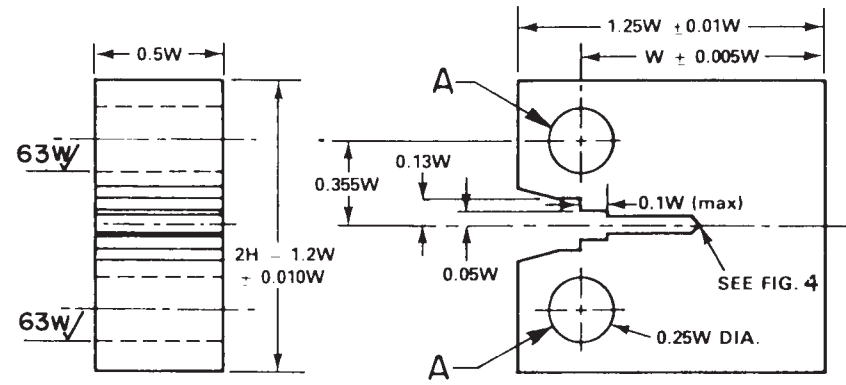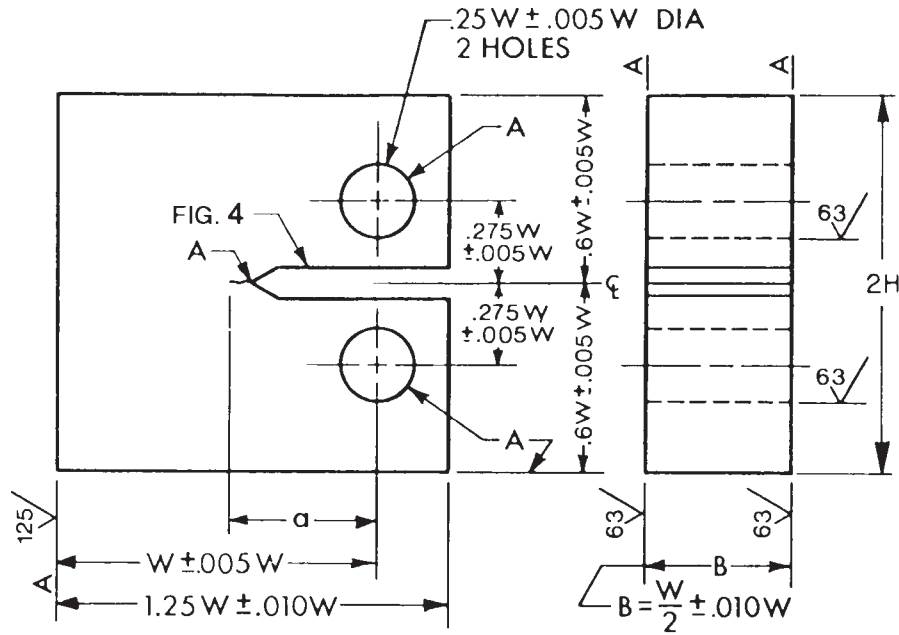

COMPACT TEST SPECIMEN FOR PIN OF 0.24W (+0.000W/ -0.005W) DIAMETER

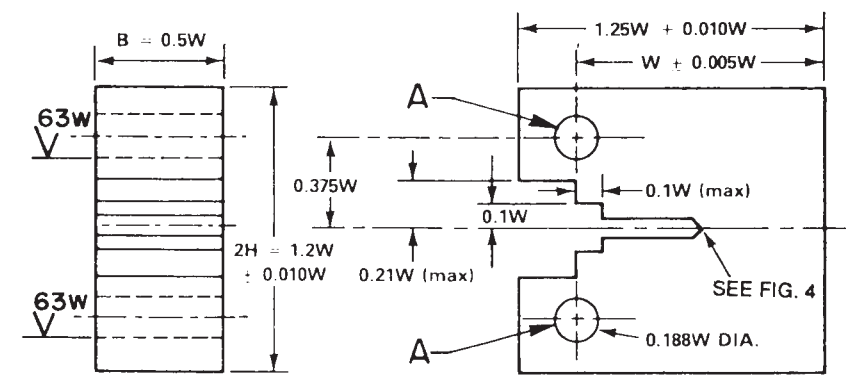


COMPACT TEST SPECIMEN FOR PIN OF 0.1875W (+0.000W/ -0.001W) DIAMETER

NOTE 1—"A" surfaces shall be perpendicular and parallel as applicable to within 0.002W TIR.

NOTE 2—The intersection of the crack starter notch tips with the two specimen surfaces shall be equally distant from the top and bottom edges of the specimen within 0.005W TIR.

FIG. 1 Recommended Compact Specimen Designs

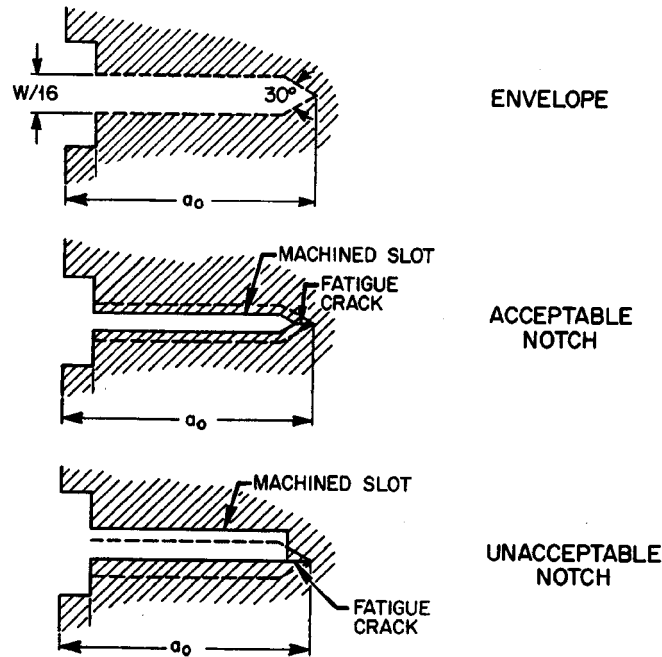

NOTE 1—Notch width need not be less than 1.6mm (1/16 in.) but not exceed W/16.

NOTE 2—The intersection of the crack starter surfaces with the two specimen faces shall be equidistant from the top and bottom edges of the specimen within 0.005W.

FIG. 4 Envelope Crack Starter Notches

$0.00013 \text{ m}^{1/2}$ ($0.00083 \text{ in.}^{1/2}$) $\pm 5\%$.⁴ Stress ratio, R , shall be controlled within the following range: $0.01 < R < 0.1$. Finish sharpening is to be started at least 0.6 mm (0.025 in.) before the end of precracking. K_{\max}/E for finish sharpening is to be $0.000096 \text{ m}^{1/2}$ ($0.0006 \text{ in.}^{1/2}$) $\pm 5\%$ and stress ratio shall be maintained in the range $0.01 < R < 0.1$. If the precracking temperature, T_1 , is different than the test temperature, T_2 , then the finish sharpening K_{\max}/E shall be equal to or less than $[\sigma_{ys(T1)}/\sigma_{ys(T2)}] 0.000096 \text{ m}^{1/2} \pm 5\%$. The lowest practical stress ratio is suggested in all cases. Finish sharpening can be expected to require between 5×10^3 to 5×10^5 cycles for most metallic test materials when using the above recommended K levels. Finish sharpening shall not take less than 10^3 cycles to produce the last 0.6 mm (0.025 in.) of growth.

8. Procedure

8.1 *Testing Procedure*—The objective of the procedure described here is to determine the J -integral at the point of crack instability, J_c . Crack growth can be measured by partial unloading compliance, or by any other method that has precision and accuracy, as defined below. However, the J -integral is not corrected for slow-stable crack growth in this test method.

8.2 *Test Preparation*—Prior to each test, certain specimen dimensions should be measured, the clip gage checked, and the starting crack size estimated from the average of the optical side face measurements.⁵

8.2.1 The dimensions B , B_N , and W shall be measured to within 0.05 mm (0.002 in.) accuracy or 0.5%, whichever is larger.

8.2.2 Because most tests conducted under this method will terminate in specimen instability, clip gages tend to be abused, thus they shall be examined for damage after each test and checked electronically before each test. Clip gages shall be calibrated at the beginning of each day of use, using an extensometer calibrator as specified in 6.4.4.

8.2.3 Follow Test Method E 1820, 8.5 for crack size measurement, 8.3.2 for testing compact specimens and 8.3.1 for testing bend specimens.

8.3 The required minimum number of valid K_{Jc} tests is specified according to the value of $K_{Jc(\text{med})}$. See also 8.5.

8.4 *Test Temperature Selection*—It is recommended that the selected temperature be close to that at which the $K_{Jc(\text{med})}$ values will be about $100 \text{ MPa}\sqrt{\text{m}}$ for the specimen size selected. Charpy V-notch data can be used as an aid for predicting a viable test temperature. If a Charpy transition temperature, T_{CVN} , is known corresponding to a 28J Charpy V-notch energy or a 41J Charpy V-notch energy, a constant C can be chosen from Table 1 corresponding to the test specimen size (defined in 3.3.15), and used to estimate⁶ the test temperature from **(9, 17)(12, 20)**.

⁴ Elastic (Young's) modulus, E , in units of MPa will result in K_{\max} in units of $\text{MPa}\sqrt{\text{m}}$. Elastic (Young's) modulus, E , in units of ksi will result in K_{\max} in units of $\text{ksi}\sqrt{\text{in.}}$.

⁵ When side-grooving is to be used, first precrack without side grooves and optically measure the fatigue crack growth on both surfaces.

⁶ Standard deviation on this estimate has been determined to be 15°C.

$$T = T_{CVN} + C \quad (2)$$

TABLE 1 Constants for Test Temperature Selection Based on Charpy Results

Specimen Size, (nT)	Constant C (°C)	
	28J	41J
0.4 ^A	-32	-38
0.5	-28	-34
1	-18	-24
2	-8	-14
3	-1	-7
4	2	-4

^A For precracked Charpy specimens, use C = -50 or -56°C.

8.4.1 This correlation is only appropriate for determining an initial test temperature. The iterative scheme described in 10.4.3 may be necessary to refine this test temperature in order to increase T_o accuracy. Testing below the temperature specified in Eq 2 may be appropriate for low upper-shelf toughness materials to avoid crack growth, and for low yield strength materials to avoid specimen size invalidity (Eq 1).⁷

8.5 *Testing Below Temperature, T_o* —When the equivalent value of $K_{Jc(med)}$ for 1T specimens is greater than 83 MPa√m, the required number of valid K_{Jc} values to perform the analyses covered in Section 10 is six. However, small specimens such as precracked Charpy specimens (Test Method E 812) can develop excessive numbers of invalid K_{Jc} values by Eq 1 when testing close to the T_o temperature. In such cases it is advisable to test at temperatures below T_o , where most, if not all, K_{Jc} data developed can be valid. The disadvantage here is that the uncertainty in T_o determination increases as the lower-shelf toughness is approached. This increase in uncertainty can be countered by testing more specimens thereby increasing the $K_{Jc(med)}$ accuracy. Table 2 establishes the number of valid K_{Jc} test results required to evaluate T_o according to this test method. If $K_{Jc(med)}$ of a data set is lower than 58 MPa√m, then the T_o determination using that data set shall not be allowed.

TABLE 2 Number of Valid K_{Jc} Test Results Required to Evaluate T_o

(T - T_o) _i range (°C)	$K_{Jc(med)}$ range ^A (MPa√m)	Number of valid K_{Jc} required	Possible number of invalid tests by Eq 1 ^B
50 to -14	212 to 84	6	3
-15 to -35	83 to 66	7	1
-36 to -50	65 to 58	8	0

^A Convert $K_{Jc(med)}$ equivalence using Eq. 16. Round off to nearest whole digit.

^B Established specifically for precracked Charpy specimens. Use this column for total specimen needs.

8.6 *Specimen Test Temperature Control and Measurement*—For tests at temperatures other than ambient, any suitable means (liquid, gas vapor, or radiant heat) may be used to cool or heat the specimens, provided the region near the crack tip can be maintained at the desired temperature as defined in 6.7 during the conduct of the test.

8.6.1 The most dependable method of monitoring test temperature is to weld or spot weld each thermocouple wire separately to the specimen, spaced across the crack plane. The specimen provides the electrical continuity between the two thermocouple wires, and spacing should be enough not to raise any question of possible interference with crack tip deformation processes. Alternative attachment methods can be mechanical types such as drilled hole, or by a firm mechanical holding device so long as the attachment method is verified for accuracy and these practices do not disturb the crack tip stress field of the specimen during loading.

8.6.2 To verify that the specimen is properly seated into the loading device and that the clip gage is properly seated, repeated preloading and unloading in the linear elastic range shall be applied. Load and unload the specimen between loads of 0.2 P_{max} and P_{max} (where P_{max} is the top precracking load of the finishing cycles) at least three times. Check the calculated crack size from each unloading slope against the average precrack size defined in 8.2. Refer also to Test Method E 1820, Eq. A2.12 for C(T) specimens and to Eq. A1.10 for SE(B) specimens. Be aware that ice buildup at the loading clevis hole between tests can affect accuracy. Therefore, the loading pins and devices should be dried before each test. For working-in fixtures, the elastic modulus to be used should be the nominally known value, E , for the material, and for side-grooved specimens, the effective thickness for compliance calculations is defined as:

$$B_e = B_N(2 - B_N/B) \quad (3)$$

8.6.3 For J calculations in Section 9, B_N is used as the thickness dimension. All calculated crack sizes should be within 10 % of the visual average and replicate determinations within 1 % of each other. If the repeatability of determination is outside this limit, the test setup is suspect and should be thoroughly rechecked. After working-in the test fixtures, the load shall be returned to the lowest practical value at which the fixture alignment can be maintained.

⁷ Data validation is covered in 8.9.2 and Section 10.

8.7 *Testing for K_{Jc}* —All tests shall be conducted under displacement control. Load versus load-point displacement measurements shall be recorded. Periodic partial unloading can be used to determine the extent of slow-stable crack growth if it occurs. Alternative methods of measuring crack extension, for example the potential drop method, can be used (158). If displacement measurements are made at a location other than at the load point, the ability to infer load point displacement within 2 % of the absolute values shall be demonstrated. In the case of the front face for compact specimens (7.1), this requirement has been sufficiently proven so that no demonstration is required. For bend bars, see 6.5.2. Crack size prediction from partial unloading slopes at a different location will require different compliance calibration equations than those recommended in 8.6.2. Table 2 in Practice E 561-92a contains equations that define compliance for other locations on the compact specimen.

8.7.1 Load specimens at a rate such that the time of loading taken to reach load P_M lies between 0.1 and 10 min. P_M is nominally 40 % of limit load; see Test Method E 1820, Eqs. A1.1 and A2.1. The crosshead speed during periodic partial unloadings may be as slow as needed to accurately estimate crack growth, but shall not be faster than the rate specified for loading.

8.7.2 Partial unloadings that are initiated between load levels P_M and $1.5P_M$ can be used to establish an “effective” elastic modulus, E_e , such that the modulus-normalized elastic compliance predicts an initial crack size within 0.001W of the actual initial crack size. The resulting E_e should not differ from an expected or theoretical E of the material by more than 10 % (see also Practice E 561-92a, Section 10). A minimum of two such unloadings should be made and the slopes should be repeatable within 1 % of the mean value. Slow-stable crack growth usually develops at loads well above $1.5P_M$ and the spacing of partial unloadings depends on judgement. As an aim, every $0.01a_o$ increment of crack growth is suitable. Use E_e in place of E and B_e for thickness to calculate crack growth.

8.8 *Test Termination*— After completion of the test, optically measure initial crack size and the extent of slow-stable crack growth or crack extension due to crack pop-in, or both, when applicable.

8.8.1 When the failure event is full cleavage fracture, determine the initial fatigue precrack size, a_o , as follows: measure the crack length at nine equally spaced points centered about the specimen centerline and extending to 0.01B from the free surfaces of plane sided specimens or near the side groove roots on side grooved specimens. Average the two near-surface measurements and combine the average of these two readings with the remaining seven crack measurements. Determine the average of those eight values. Measure the extent of slow-stable crack growth if it develops applying the same procedure. The measuring instruments shall have an accuracy of 0.025 mm (0.001 in.).

8.9 *Qualification of Data:*

8.9.1 The K_{Jc} datum shall be considered a non-test and discarded if any of the nine physical measurements of the starting crack size differ by more than 5 % of thickness dimension, B, or 0.5 mm, whichever is larger, from the average defined in 8.8.1.

8.9.2 A K_{Jc} datum is invalid if the specimen exceeds $K_{Jc(limit)}$ requirement of 7.5, or if a test has been discontinued at a value of K_J without cleavage fracture after surpassing $K_{Jc(limit)}$. For tests that terminate in cleavage after more than $0.05(W-a_o)$ or 1 mm (0.040 in.), whichever is smaller, of slow-stable crack growth, corresponding to the longest crack length dimension measured by section 8.8.1, resulting K_{Jc} value also shall be regarded as invalid. Should both the $K_{Jc(limit)}$ and the maximum crack growth validity criteria be violated, the lower value of the two shall prevail for data censoring purposes. When K_J or K_{Jc} values are invalid, these data contain statistically useable information that can be applied as censored data in 10.2.2 or 10.4.2 as appropriate.

8.9.3 For any test terminated with no cleavage fracture, and for which the final K_J value does not exceed either validity limit, cited in 8.9.2, the test record is judged to be a nontest, the result of which shall be discarded.

8.9.4 Data sets that contain all valid K_{Jc} values can be used without modification in Section 10. Data sets that contain some invalid data but that meet the requirements of 8.5 can be used with data censoring (10.2.2). Remedies for excessive invalid data include (1) testing at a lower test temperature, (2) testing with larger specimens, or (3) testing more specimens to satisfy the minimum data requirements.

8.9.5 A discontinuity in a load-displacement record, that may be accompanied by a distinct sound like a click emanating from the test specimen, is probably a pop-in event. All pop-in crack initiation K values for cracks that advance by a cleavage-driven mechanism are to be regarded as eligible K_{Jc} data. It is recognized that test equipment can at times introduce false pop-in indications in test records. If a questionable discontinuity develops, stop the loading as soon as possible and assess the compliance ratio by 9.2. If the compliance change leads to a ratio calculated by 9.2 that is greater than the calculated ratio corresponding to more than a 1 % increase in crack size, the recommended practice is to assume that a pop-in event has occurred and to terminate the test, followed by heat tinting and breaking the specimen open at liquid nitrogen temperature. Measure the initial crack size and calculate K_{Jc} , for the pop-in load, based on that crack size. Measure the post pop-in crack size visually and record it. If there is no evidence of crack extension by cleavage, then the K_{Jc} value at the discontinuity point is not a part of the K_{Jc} data distribution.

9. Calculations

9.1 Determine the J-integral at onset of cleavage fracture as the sum of elastic and plastic components:

$$J_c = J_e + J_p \quad (4)$$

9.1.1 For compact specimens, $C(T)$, the elastic component of J is calculated as follows:

$$J_e = \frac{(1 - \nu^2) K_e^2}{E} \quad (5)$$

where:

$$K_e = [P/(BB_N W)^{1/2}] f(a_o/W),$$

$$f(a_o/W) = \frac{(2 + a_o/W)}{(1 - a_o/W)^{3/2}} [0.886 + 4.64(a_o/W) - 13.32(a_o/W)^2 + 14.72(a_o/W)^3 - 5.6(a_o/W)^4], \quad (6)$$

and a_o = initial crack size.

9.1.2 For disk-shaped compact specimens, $DC(T)$, the elastic component of J is calculated as follows:

$$J_e = \frac{(1 - \nu^2) K_e^2}{E} \quad (7)$$

where:

$$K_e = [P/(BB_N W)^{1/2}] f(a_o/W),$$

$$f(a_o/W) = \frac{(2 + a_o/W)}{(1 - a_o/W)^{3/2}} [0.76 + 4.8(a_o/W) - 11.58(a_o/W)^2 + 11.43(a_o/W)^3 - 4.08(a_o/W)^4], \quad (8)$$

and a_o = initial crack size.

9.1.3 For SE(B) specimens of both $B \times B$ and $B \times 2B$ cross sections and span-to-width ratios of 4, the elastic component of J is calculated as follows:

$$J_e = \frac{(1 - \nu^2) K_e^2}{E} \quad (9)$$

where:

$$K_e = \{PS/[(BB_N)^{1/2} W^{3/2}]\} f(a_o/W),$$

$$f(a_o/W) = \frac{3(a_o/W)^{1/2}}{2[1 + 2(a_o/W)]} \frac{1.99 - (a_o/W)(1 - a_o/W)[2.15 - 3.93(a_o/W) + 2.7(a_o/W)^2]}{(1 - a_o/W)^{3/2}}, \quad (10)$$

and a_o = the initial crack size.

9.1.4 The plastic component of J is calculated as follows:

$$J_p = \frac{\eta A_p}{B_N b_o} \quad (11)$$

where:

$$A_p = A - 1/2 C_o P^2,$$

$$A = A_e + A_p \text{ (see Fig. 5),}$$

C_o = reciprocal of the initial elastic slope, V/P (Fig. 5), and

b_o = initial remaining ligament.

9.1.4.1 For standard and disk-shaped compact specimens, A_p is based on load-line displacement (LLD) and $\eta = 2 + 0.522 b_o/W$. For bend bar specimens of both $B \times B$ and $B \times 2B$ cross sections and span-to-width ratios of 4, A_p may be based on either LLD or crack-mouth opening displacement (CMOD). Using LLD, $\eta = 1.9$. Values of η for bend bars based on CMOD are discussed in 6.5.2.

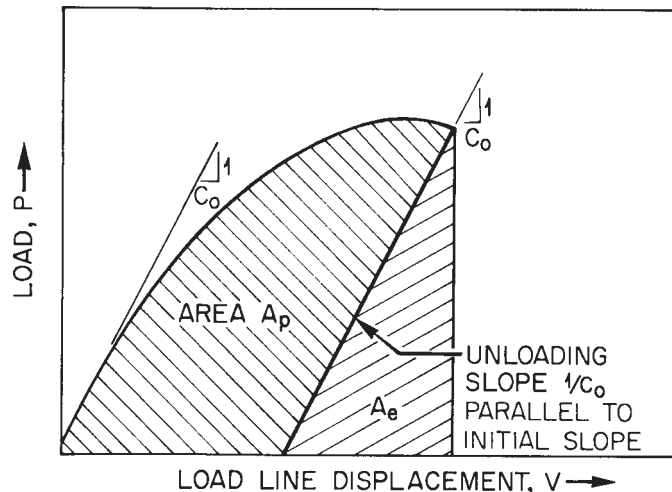


FIG. 5 Definition of the Plastic Area for J_p Calculations

9.1.5 K_{Jc} is determined for each datum from J at onset of cleavage fracture, J_c . Assume plane strain for elastic modulus, E :

$$K_{Jc} = \sqrt{J_c \frac{E}{1 - \nu^2}} \tag{12}$$

9.1.6 All data with K_{Jc} in excess of the limits prescribed in 8.9.2 are considered invalid, but values can be used in the censoring analysis that is described in 10.2.2 or 10.4.2 as appropriate. Invalid data developed as a part of a data set disqualifies that data set for analysis by 10.2.1.

9.2 *Pop-in Evaluation*—Test records that can be used for K_{Jc} analyses are those that show complete specimen separation due to cleavage fracture and those that show pop-in. If a load-displacement record shows a small but perceptible discontinuity without the audible click of the typical pop-in, a mid-test decision will be needed. Following Fig. 6, determine the post pop-in to initial compliance ratio, C_i/C_o , and compare this to the value of the right-hand side of the following inequality which implies that a pop-in has occurred:

$$\frac{C_i}{C_o} > \left[1 + 0.01 \eta \left(\frac{W}{a_o} - 1 \right)^{-1} \right] \tag{13}$$

where:

a_o = nominal initial crack size (high accuracy on dimension a_o is not required here), and

η = parameter based on LLD defined in 9.1.4.1.

Eq 13 involves the use, by approximation, of the plastic parameter, η , in an otherwise elastic equation, as suggested in Test Method E 1820. When $a_o/W = 0.5$, C_i/C_o shall be greater than 1.02, to follow the pop-in evaluation procedure prescribed in 8.9.5.

9.3 *Outlier*—Occasionally, an individual K_{Jc} datum will appear to deviate greatly from the remainder of the data set. The impact and character of this datum can be evaluated as follows. First determine the 2 % and 98 % tolerance bounds using the equations below:

$$K_{Jc(0.02)} = 0.415 K_{Jc(\text{med})} + 11.70 \text{ MPa}\sqrt{\text{m}} \tag{14}$$

$$K_{Jc(0.98)} = 1.547 K_{Jc(\text{med})} - 10.94 \text{ MPa}\sqrt{\text{m}}$$

If the suspected datum is outside the tolerance bounds dictated by Eqs. (14) (for example, $K_{Jc} < K_{Jc(0.02)}$ or $K_{Jc} > K_{Jc(0.98)}$) it may be possible to reduce the influence of the outlier datum on $K_{Jc(\text{med})}$ by testing additional specimens. Typically, a total of 12 replicate specimens is sufficient. However, outliers shall not be discarded from the data utilized to calculate $K_{Jc(\text{med})}$. The emergence of additional outliers may indicate that the test material is not homogenous.

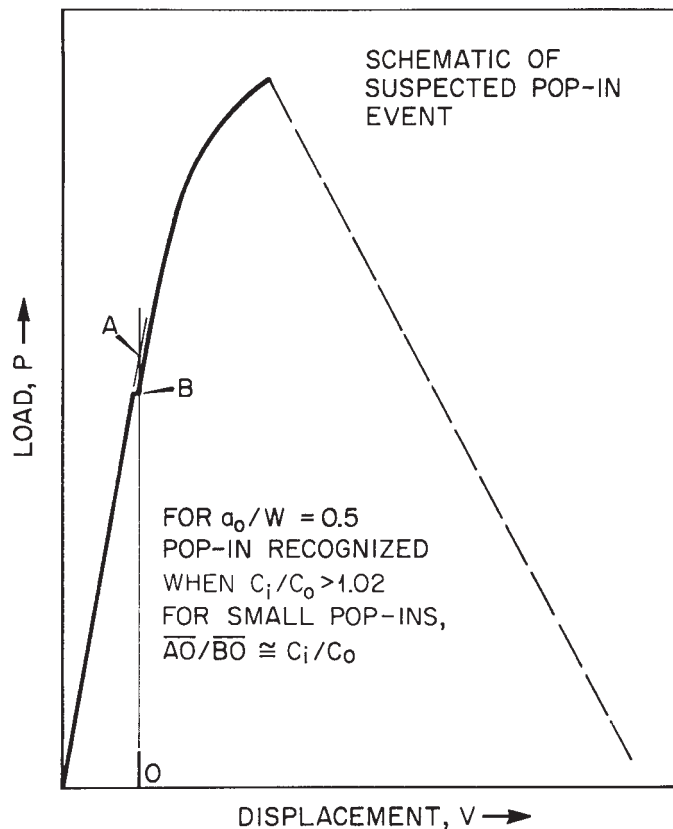


FIG. 6 Schematic of Pop-in Magnitude Evaluation

10. Prediction of Size Effects and Transition Temperature

10.1 Weibull Fitting of Data Sets :

10.1.1 *Test Replication*—A data set consists of at least six valid replicate test results determined at one test temperature, or the equivalent thereof; see also 8.5 for single temperature and 10.4 for multi-temperature requirements.

10.1.2 *Determination of Scale Parameter, K_o , and median $K [K_{Jc(med)}]$* —The three-parameter Weibull model is used to define the relationship between K_{Jc} and the cumulative probability for failure, p_f . The term p_f is the probability for failure at or before K_{Jc} for an arbitrarily chosen specimen taken from a large population of specimens. Data samples of six or more specimens are used to estimate the true value of scale parameter, K_o , for the following Weibull model:

$$p_f = 1 - \exp \left\{ - \left[\frac{K_{Jc} - K_{min}}{K_o - K_{min}} \right]^b \right\} \quad (15)$$

10.1.3 Ferritic steels of yield strengths ranging from 275 to 825 MPa (40 to 120 ksi) will have fracture toughness cumulative probability distributions of nearly the same shape, independent of specimen size and test temperature, when K_{min} is set at 20 MPa√m (18.2 ksi√in.). The shape of the distribution is defined by the Weibull exponent, b , which tends to be near 4. Scale parameter, K_o , is the data fitting parameter determined when using the maximum likelihood statistical method of data fitting (218). When K_{Jc} and K_o in Eq. 15 are equal, $P_f = 0.632$.

10.1.4 *Size Effect Prediction*—The statistical weakest-link theory is used to model specimen size effect in the transition range between lower shelf and upper shelf fracture toughness. The following Eq. 16 can be used to size adjust individual K_{Jc} values, $K_{Jc(med)}$, or K_o . K_{Jc} serves as the example case:

$$K_{Jc(x)} = K_{min} + [K_{Jc(o)} - K_{min}] \left(\frac{B_o}{B_x} \right)^{1/4} \quad (16)$$

where:

- $K_{Jc(o)}$ = K_{Jc} for a specimen size B_o ,
- B_o = gross thickness of test specimens (side grooves ignored),
- B_x = gross thickness of prediction (side grooves ignored), and
- K_{min} = 20 MPa√m (18.2 ksi√in.).

10.2 The recommendation advanced by this standard test method is to perform K_{Jc} data replication at a single test temperature, as near as possible to an estimated T_o temperature. However, all data obtained at temperatures within the range $-50^\circ\text{C} \leq (T - T_o) \leq 50^\circ\text{C}$ shall be considered in the determination of T_o . Therefore, if testing is performed at more than one temperature, the multi-temperature procedure described in 10.4.2 shall be used. In this case, the combination of valid specimen numbers and test temperatures shall satisfy Eq. (22) in 10.4.1. Iteration in terms of testing additional specimens may be required. For single-temperature tests, use 8.4 or 8.5 for test temperature estimation assistance. The following sections 10.2.1 and 10.2.2 can be used to calculate the scale parameter, K_o , for data developed at a single test temperature and consisting of at least six valid K_{Jc} values, or the equivalent thereof, see also 8.5. Data sets containing only valid data (as defined in 8.9.2) shall be analyzed as per 10.2.1. Paragraph 10.2.2 shall be applied if any invalid data (as defined in 8.9.2) exist.

10.2.1 *Determination of K_o with all Valid Data*—If the data are generated from specimens of other than 1T size, the data must first be converted to 1T size equivalence using Eq. (16) (see section 3.3.15). The following Eq. (17) shall be then applied to determine K_o :

$$K_o = \left[\sum_{i=1}^N \frac{(K_{Jc(i)} - K_{min})^4}{N} \right]^{1/4} + K_{min} \quad (17)$$

where:

- N = number of specimens tested as defined in 8.9, and
- K_{min} = 20 MPa√m (18.2 ksi√in.).

See X1.2 for an example solution.

10.2.2 *Determination of K_o with Censored Data*—Replace all invalid K_{Jc} values (8.9.2) with dummy K_{Jc} values. If invalidity was due to violation of $K_{Jc(limit)}$, Eq. (1), the experimental K_{Jc} value shall be replaced by $K_{Jc(limit)}$ for the specimen size used. Use the material yield strength at the test temperature. In the case of K_{Jc} invalidity due to exceeding the 0.05($W - a_o$) or 1-mm (0.04-in.) limitation on stable crack growth (8.9.2), the K_{Jc} test value shall be replaced with the highest valid K_{Jc} in the data set for any specimen size. The Weibull scale parameter, K_o , shall be calculated using the following Eq. (18), in which all $K_{Jc(i)}$ and dummy values for specimens other than 1T size are converted to 1T size equivalence, using Eq. (16). See section 3.3.15 and X1.3 for example solution.

$$K_o = \left[\sum_{i=1}^N \frac{(K_{Jc(i)} - K_{min})^4}{r} \right]^{1/4} + K_{min} \quad (18)$$

where:

- r = number of valid data as defined in 8.9,
- K_{min} = 20 MPa√m (18.2 ksi√in.), and

N = number of data (valid and invalid).

10.2.3 K_o to $K_{Jc(med)}$ Conversion—The scale parameter, K_o calculated according to either, 10.2.1 or 10.2.2, corresponds to a 63 % cumulative probability level for specimen failure by cleavage. The median K_{Jc} of a data population corresponds to 50 % cumulative probability for fracture and $K_{Jc(med)}$ can be determined from K_o using the following:

$$K_{Jc(med)} = K_{min} + (K_o - K_{min}) [1n(2)]^{1/4} \quad (19)$$

where:

$$K_{min} = 20 \text{ MPa}\sqrt{\text{m}} \text{ (18.2 ksi}\sqrt{\text{in.}}).$$

10.3 *Establishment of a Transition Temperature Curve (Master Curve)*—Transition temperature K_{Jc} data tend to conform to a common toughness versus temperature curve shape in the same manner as the ASME K_{Ic} and K_{IR} lower-bound design curves **(18, 19)(21, 22)** . **For this method, the shape of the median K_{Jc} toughness, $K_{Jc(med)}$, for 1T specimens (3.3.15) is described by:**

$$K_{Jc(med)} = 30 + 70 \exp [0.019(T - T_o)], \text{ MPa}\sqrt{\text{m}}, \quad (20)$$

where:

T = test temperature ($^{\circ}\text{C}$), and

T_o = reference temperature ($^{\circ}\text{C}$).

10.3.1 Master curve positioning involves the determination of T_o using the computational steps presented below.

10.3.2 *Determine Reference Temperature (T_o)* —Use only 1T $K_{Jc(med)}$ values, converted by Eq. 16 if necessary.

$$T_o = T - \left(\frac{1}{0.019} \right) \ln \left[\frac{K_{Jc(med)} - 30}{70} \right] \quad (21)$$

Units of $K_{Jc(med)}$ are in $\text{MPa}\sqrt{\text{m}}$; units of T_o are in $^{\circ}\text{C}$.

10.4 *Multi-temperature Option*—The reference temperature, T_o , should be relatively independent of the test temperature that has been selected. Hence, data that are distributed over a restricted temperature range, namely $T_o \pm 50^{\circ}\text{C}$, can be used to determine T_o . As it is with the single test temperature option, a minimum of six valid K_{Jc} data (8.9.2) or the equivalence, by weight factor, described in 10.4.1 below is required. In the case of data generated at test temperatures from 14°C below T_o to 50°C above T_o , the minimum requirement of six valid data will be satisfactory.

10.4.1 Data generated at test temperatures in the range of $T_o - 50$ to $T_o - 14^{\circ}\text{C}$ are considered to make reduced accuracy contribution to T_o determinations. As a consequence, more data development within the aforementioned temperature range is required. The following weighting system specifies the required number of data:

$$\sum_{i=1}^3 r_i n_i \geq 1 \quad (22)$$

where r_i is the number of valid specimens within the i -th temperature range, $(T - T_o)$, and n_i is the specimen weighting factor for the same temperature range as shown in Table 3.

10.4.2 All K_{Jc} data, including valid and dummy values resulting from Eq. 1 violation at each test temperature, must first be converted to 1T equivalence using Eq. 16. If the slow-stable crack growth limitation is violated as specified in 8.9.2, the highest valid K_{Jc} shall be used for censoring. The $K_{Jc(limit)}$ in 8.9.2 shall be chosen from data at any temperature as this value should be largely temperature insensitive. Also this value is specimen-size-independent and size correction of this limit shall not be performed. The K_J value corresponding to J_{Ic} also can be used for crack growth censoring if J_{Ic} is known for the test material. The following equality shall be used to determine T_o for tests made at varied temperatures **(18, 20)(21, 23)** :

$$\sum_{i=1}^N \delta_i \frac{\exp [0.019 (T_i - T_o)]}{11 + 77 \exp [0.019 (T_i - T_o)]} - \sum_{i=1}^N \frac{(K_{Jc(i)} - 20)^4 \exp [0.019 (T_i - T_o)]}{\{11 + 77 \exp [0.019 (T_i - T_o)]\}^5} = 0 \quad (23)$$

TABLE 3 Weight Factors for Multi-Temperature Analysis

$(T - T_o)$ range ^A ($^{\circ}\text{C}$)	1T $K_{Jc(med)}$ range ^A ($\text{MPa}\sqrt{\text{m}}$)	Weight factor n_i
50 to -14	212 to 84	1/6
-15 to -35	83 to 66	1/7
-36 to -50	65 to 58	1/8

^A Rounded off to the closest integer.

where:

- N = number of specimens tested,
- T_i = test temperature corresponding to $K_{Jc(i)}$,
- $K_{Jc(i)}$ = either a valid K_{Jc} datum or dummy value substitute for an invalid datum (section 8.9.2). All K_{Jc} input values, valid or dummy K_{Jc} , must be converted to 1T equivalence (section 3.3.15) before entry,
- δ_i = 1.0 if the datum is valid or zero if the datum is a dummy substitute value,
- 11 = integer equivalent of $10/(\ln 2)^{1/4}$ MPa \sqrt{m} , and
- 77 = integer equivalent of $70/(\ln 2)^{1/4}$ MPa \sqrt{m} .

Solve Eq. 23 for T_o temperature by iteration.

10.4.3 Since the valid test temperature range is only known after T_o has been determined, the following iterative scheme may be helpful for identifying proper test temperature. Choose an initial test temperatures as described within 8.4 using the value of “C” appropriate for the test specimen size. Conduct 3-4 valid tests at this temperature and evaluate a preliminary T_o value using 10.2 to determine K_o . Base all subsequent test temperatures on this preliminary value of T_o . See Appendix X3 for an example solution.

10.4.4 Certain multi-temperature data sets may result in an oscillating iteration between two (or more) distinct T_o values upon satisfying the $T_o \pm 50^\circ\text{C}$ limit of 10.4. In these instances, the T_o value reported shall be the average of the calculated values. One example is for hypothetical data with toughness values such that the initial T_o estimation requires that data at one temperature be excluded. The second iteration then results in the inclusion of this same data. Subsequent T_o iterations will then oscillate between the original first and second estimations. This phenomenon is more likely for sparse data sets when test results exist near the $T_o \pm 50^\circ\text{C}$ limit. More testing near the average T_o will likely resolve this problem.

10.5 K_{Jc} values that are developed using specimens or test practices or both, that do not conform to the requirements of this method can be used to establish the temperature of 100 MPa \sqrt{m} fracture toughness. Such temperatures shall be referred to as T_Q . Currently existing experimental evidence indicates that data populations developed without the controlled constraint conditions required by the present standard method are apt to have Weibull slopes that are other than 4 and, as such, the use of the equations provided here and the use of the master curve toughness trend to determine T_Q is not technically justifiable. Hence, values of T_Q are of use for unique circumstances only and are not to be regarded as provisional values of T_o .

10.6 *Uses for Master Curve*—The master curve can be used to define a transition temperature shift related to metallurgical damage mechanisms. Fixed values of Weibull slope and median K_{Jc} define the standard deviation; hence the representation of data scatter. This information can be used to calculate tolerance bounds on toughness, for the specimen reference size chosen. The data scatter characteristics modeled here can also be of use in probabilistic fracture mechanics analysis, bearing in mind that the master curve pertains to a 1T size specimen. The master curve determined by this procedure pertains to cleavage fracture behavior of ferritic steels. Extensive ductile tearing beyond the validity limit set in 8.9.2, may precede cleavage as the upper-shelf range of temperature is approached. Such data can be characterized by separate methods (see Test Method E 1820).

11. Report

11.1 Report the following information:

- 11.1.1 Specimen type, specimen thickness, B , net thickness, B_N , specimen width, W ,
- 11.1.2 Specimen initial crack size,
- 11.1.3 Visually measured slow-stable crack growth to failure, if evident,
- 11.1.4 Crack plane orientation according to Terminology E 1823,
- 11.1.5 Test temperature,
- 11.1.6 Number of valid specimens and total number of specimens tested at each temperature,
- 11.1.7 Crack pop-in and compliance ratio, C_i/C_o ,
- 11.1.8 Material yield strength and tensile strength,
- 11.1.9 The location of displacement measurement used to obtain the plastic component of J (load-line or crack-mouth),
- 11.1.10 A list of individual K_{Jc} values and the median $K_{Jc(\text{med})}$ (MPa \sqrt{m}) obtained from that list,
- 11.1.11 Reference temperature on master curve, T_o ($^\circ\text{C}$),
- 11.1.12 Fatigue precracking condition in terms of K_{max} for the last 0.64 mm (0.025 in.) of precrack growth, and
- 11.1.13 Difference between maximum and minimum crack length measurement expressed as a percentage of the initial crack size.

11.2 The report may contain the following supplementary information:

- 11.2.1 Specimen identification codes,
- 11.2.2 Measured pop-in crack extensions, and
- 11.2.3 Load-displacement records.

12. Precision and Bias

12.1 *Precision*—The variability of material toughness in the transition range is an accepted fact and the modeling of the data scatter is an integral feature of this test procedure. It has been observed that when K_{min} of 20 MPa \sqrt{m} is used as a deterministic parameter in the three-parameter Weibull statistical model, K_{Jc} data distributions will tend to display a Weibull slope of

approximately 4. Small sample sizes, such as required by 8.5, are prone at times to show slopes that vary randomly above and below 4, but such behavior does not necessarily indicate a lack-of-precision problem. This variability becomes small only with extremely large sets of specimens (811). Despite slope variations with sample sizes, the median K_{Jc} will be within 20 % of the true median of the full data population and it is this value that is used to establish the reference temperature, T_o . The number of specimens required by this standard is increased for tests performed at temperatures below T_o . Tests that use more than the minimum number of six specimens have increased precision of $K_{Jc(med)}$ determination. This is required at test temperatures approaching lower shelf where more precision is needed to maintain an equal uncertainty level in the T_o determination. If reference temperatures, T_o , are calculated from $K_{Jc(med)}$ values determined at several test temperatures, some scatter can be expected. The standard deviation of this scatter is defined by Eq X4.1 in Appendix X4. Eq X4.3 solved using the sample size required for validity and applied with a standard normal deviate for 85 % confidence suggests that T_o values determined at different temperatures can be expected to be within a scatter band of 20°C (12, 19) (15, 22).

12.2 *Bias*—FAs discussed in 1.3, there is no accepted an expected bias among T_o values as a function of the standard value for specimen type. The bias size is expected to increase inversely to the fracture toughness strain hardening ability of the test material at a specific material. In given yield strength. On average, T_o values obtained from C(T) specimens are higher than T_o values obtained from SE(B) specimens. Best estimate comparison indicates that the average difference between C(T) and SE(B)-derived T_o values is approximately 10°C (2). C(T) and SE(B) T_o differences up to 15°C have also been recorded (3). However, comparisons of a true known value, no statement concerning bias can be made. individual, small datasets may not necessarily reveal this average trend. Datasets which contain both C(T) and SE(B) specimens may generate T_o results which fall between the T_o values calculated using solely C(T) or SE(B) specimens.

APPENDIXES

(Nonmandatory Information)

X1. WEIBULL FITTING OF DATA

X1.1 Description of the Weibull Model:

X1.1.1 The three-parameter Weibull model is used to fit the relationship between K_{Jc} and the cumulative probability for failure, p_f . The term p_f is the probability for failure at or before K_{Jc} for an arbitrarily chosen specimen from the population of specimens. This can be calculated from the following:

$$p_f = 1 - \exp \left\{ - \left[\frac{K_{Jc} - K_{min}}{K_o - K_{min}} \right]^b \right\} \quad (X1.1)$$

X1.1.2 Ferritic steels of yield strengths ranging from 275 to 825 MPa (40 to 120 ksi) will have fracture toughness distributions of nearly the same shape when K_{min} is set at 20 MPa√m (18.2 ksi√in.). This shape is defined by the Weibull exponent, b , which is constant at 4. Scale parameter, K_o , is a data-fitting parameter. The procedure is described in X1.2.

X1.2 *Determination of Scale Parameter, K_o , and Median K_{Jc}* —The following example illustrates the use of 10.2.1. The data came from tests that used 4T compact specimens of A533 grade B steel tested at -75°C. All data are valid and the chosen equivalent specimen size for analysis will be 1T.

Rank (i)	$K_{Jc(4T)}$ (MPa√m)	$K_{Jc(1T)}$ Equivalent (MPa√m)
1	59.1	75.3
2	68.3	88.3
3	77.9	101.9
4	97.9	130.2
5	100.9	134.4
6	112.4	150.7

$$K_{o(1T)} = \left[\sum_{i=1}^N \frac{(K_{Jc(i)} - 20)^4}{N} \right]^{1/4} + 20 \quad (X1.2)$$

$$N = 6$$

$$K_{o(1T)} = 123.4 \text{ MPa}\sqrt{\text{m}}$$

X1.2.1 Median K_{Jc} is obtained as follows:

$$K_{Jc(med)} = 20 + (K_{o(1T)} - 20) (0.9124) \text{ MPa}\sqrt{\text{m}} \quad (X1.3)$$

$$= 114.4 \text{ MPa}\sqrt{\text{m}}$$

X1.2.2

$$T_o = T - \left(\frac{1}{0.019} \right) \ln \left[\frac{K_{Jc(\text{med})} - 30}{70} \right] \quad (\text{X1.4})$$

$$= -85^\circ\text{C}$$

X1.3 Data Censoring Using the Maximum Likelihood Method:

X1.3.1 *Censoring When $K_{Jc(\text{limit})}$ is Violated*—The following example uses 10.2.2 where all tests have been made at one test temperature. The example data set is artificially generated for a material that has a T_o reference temperature of 0°C . Two specimen sizes are 1/2T and 1T with six specimens of each size. Invalid K_{Jc} values and their dummy replacement $K_{Jc(\text{limit})}$ values will be within parentheses.

X1.3.2 The data distribution is developed with the following assumptions:

Material yield strength = 482 MPa or 70 ksi
 T_o temperature = 0°C
 Test temperature = 38°C
 1/2T and 1T specimens; all $a/W = 0.5$

X1.3.3 $K_{Jc(\text{limit})}$ values in $\text{MPa}\sqrt{\text{m}}$ from Eq. 1.

	0.5T	1T
Specimen size	206	291
1T equivalent	176	291

X1.3.4 Simulated Data Set:

Raw Data (K_{Jc} , $\text{MPa}\sqrt{\text{m}}$)		Size Adjusted ($K_{Jc(1T)}$, $\text{MPa}\sqrt{\text{m}}$)	
1/2T	1T	1/2T ^A	1T
138.8	119.9	119.9	119.9
171.8	147.6	147.6	147.6
195.2	167.3	167.3	167.3
(216.2)	185.0	(176)	185.0
(238.5)	203.7	(176)	203.7
(268.3)	228.8	(176)	228.8

$$^A K_{Jc(1T)} = (K_{Jc(0.5T)} - 20) (1/2 / 1)^{1/4} + 20 \text{ MPa}\sqrt{\text{m}}$$

$$K_{o(1T)} = \left[\sum_{i=1}^N \frac{(K_{Jc(i)} - 20)^4}{r} \right]^{1/4} + 20 \quad (\text{X1.5})$$

where:

$N = 12$,
 $r = 9$,
 $K_{o(1T)} = 188 \text{ MPa}\sqrt{\text{m}}$,
 $K_{Jc(\text{med})} = 174 \text{ MPa}\sqrt{\text{m}}$, and
 $T_o = 0^\circ\text{C}$.

X1.3.5 *Censoring When $\Delta a_p \leq 0.05(W - a_p)$, not to Exceed 1 mm Limit is Violated*—The following example uses 10.2.2 where all tests have been made at a single test temperature of 38°C . Assume that the test material has properties as defined in X1.3.2 and toughness data as defined in X1.3.4. However, for this example assume that the steel has a low upper shelf. The crack growth limit (see 8.9.2) is 0.64 mm and 1 mm for 0.5T and 1T specimen respectively. The K_J value after 0.64 mm of slow-stable growth is only 197 $\text{MPa}\sqrt{\text{m}}$ and after 1 mm of slow-stable growth is only 202 $\text{MPa}\sqrt{\text{m}}$. Therefore, the crack growth limit controls all censoring. The K_J - R curve is specimen size independent so that both 0.5T and 1T specimens will have censored data. In this case the dummy replacement value as per 10.2.2 is the highest ranked valid K_{Jc} value.

Raw Data				1T Size Adjusted Data	
0.5T		1T		0.5T ^A	1T
Δa_p , mm	K_{Jc} , $\text{Mpa}\sqrt{\text{m}}$	Δa_p , mm	K_{Jc} , $\text{Mpa}\sqrt{\text{m}}$	K_{Jc} , $\text{Mpa}\sqrt{\text{m}}$	K_{Jc} , $\text{Mpa}\sqrt{\text{m}}$
0.00	138.8	0.00	119.9	119.9	119.9
0.25	171.8	0.15	147.6	147.6	147.6
0.50	195.2	0.20	167.3	167.3	167.3
0.67	(216.2)	0.55	185.0	(167.3)	185
0.70	(238.5)	1.10	(203.7)	(167.3)	(185)
0.71	(268.3)	1.15	(228.8)	(167.3)	(185)

$$^A K_{Jc(1T)} = K_{Jc(0.5T)} - 20 \cdot (0.5 / 1)^{1/4} + 20 \text{ Mpa}\sqrt{\text{m}}$$

$$K_{o(1T)} = \left[\sum_{i=1}^N \frac{(K_{Jc(i)} - 20)^4}{r} \right]^{1/4} + 20 \quad (\text{X1.6})$$

where:

- $N = 12,$
- $r = 7,$
- $K_{o(1T)} = 186 \text{ MPa}\sqrt{\text{m}},$
- $K_{Jc(\text{med})} = 171 \text{ MPa}\sqrt{\text{m}},$ and
- $T_o = 1^\circ\text{C}.$

X2. MASTER CURVE FIT TO DATA

X2.1 Select Test Temperature (see 8.4):

- X2.1.1 Six 1/2 T compact specimens,
- X2.1.2 A 533 grade B base metal, and
- X2.1.3 Test temperature, $T = -75^\circ\text{C}.$

X2.2 In this data set, there are no censored data.

Rank (i)	$K_{Jc(1/2T)}$ (MPa√m)	$K_{Jc(1T)}$ Equivalent (MPa√m)
1	91.4	80.0
2	103.1	89.9
3	120.3	104.3
4	133.5	115.4
5	144.4	124.6
6	164.0	141.1

X2.3 Determine K_o using Eq X1.2:


$K_{o(1T)} = 115.8 \text{ MPa}\sqrt{\text{m}},$ and
 $K_{Jc(\text{med})} = [\ln(2)]^{1/4} (K_o - 20) + 20 = 107.4 \text{ MPa}\sqrt{\text{m}}.$

X2.4 Position Master Curve:

$$T_o = T - (0.019)^{-1} \ln [(K_{Jc(\text{med})} - 30)/70] \tag{X2.1}$$

$$= -75 - \ln[(108.5 - 30)/70]/0.019 = -80^\circ\text{C}.$$

X2.5 Master Curve :

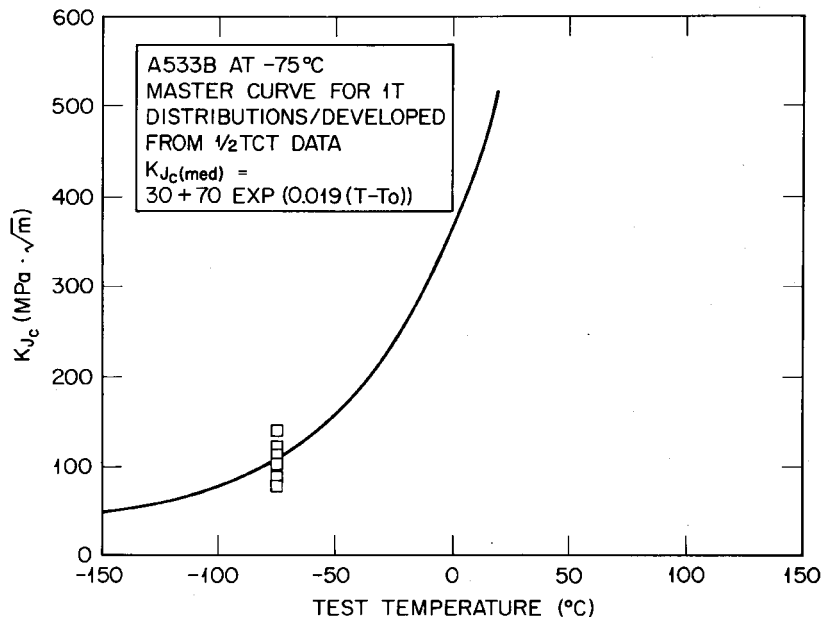

NOTE 1—Toughness data are converted to 1T equivalence.

FIG. X2.1 Master Curve for 1T Specimens Based on 1/2T Data Tabulated in Step X2.2

$$K_{Jc(\text{med})} = 30 + 70 \exp[0.019(T + 80)] \quad (\text{X2.2})$$

X2.5.1 See Fig. X2.1.

X3. EXAMPLE MULTITEMPERATURE T_o DETERMINATION

X3.1 *Material:*

A533 Grade B plate
 Quenched and tempered
 900°C WQ; and 440°C (5 h) temper

X3.2 *Mechanical Properties:*

Yield strength: 641 MPa (93 ksi)
 Tensile strength: 870 MPa (117.5 ksi)
 Charpy V:
 28-J temperature = -5°C (23°F)
 41-J temperature = 16°C (61°F)
 NDT: 41°C (106°F)

X3.3 K_{Jc} Limit Values:

Specimen Types:

1/2T C(T) with $a_o/W = 0.5$
 1T SE(B) with $a_o/W = 0.5$

Test Temperature (°C)	Yield Strength (MPa)	$K_{Jc(\text{limit})}$ (MPa√m)	
		1/2T	1T
-10	651	239	338
-5	649	238	337
0	648	238	337
23	641	237	335

X3.4 *Slow-stable Crack Growth Limits:*

$$K_{Jc(1\text{ mm})} = 263 \text{ MPa}\sqrt{\text{m}} \text{ for 1T SE(B) specimen;}$$

$$K_{Jc(0.64\text{ mm})} = 255 \text{ MPa}\sqrt{\text{m}} \text{ for 1/2T C(T) specimen}$$

X3.5 *Estimation Procedure #1 from Charpy Curve:*

$$T_{o(\text{est})} = T_{28J} + C = -5^\circ - 18^\circ = -23^\circ\text{C}$$

$$T_{o(\text{est})} = T_{41J} + C = 16^\circ - 24^\circ = -8^\circ\text{C}$$

Conduct four 1T SE(B) tests at -20°C.

X3.6 T_o Estimation Procedure #2 from Results of First Four Tests:

First four tests at -20°C:

K_{Jc} , MPa√m
135.1
108.9
177.1
141.7

Calculate preliminary $T_{o(\text{est})\#2}$ from data to determine allowable test temperature range:

$$K_{Jc(\text{med})} = 137 \text{ MPa}\sqrt{\text{m}};$$

$$T_{o(\text{est})\#2} = -42^\circ\text{C}$$

Estimated temperature range or usable data:

$$= T_{o(\text{est})\#2} \pm 50^\circ\text{C}$$

$$= -92^\circ\text{C} < T_i < +8^\circ\text{C}$$

Now conduct additional testing within this range for T_o determination.

X3.7 *Calculation of T_o (Eq. 23):*

Use data between -92°C and 8°C based on $T_{o(\text{est})\#2}$

TABLE X3.1 Data Tabulation

Test temperature, (°C)	Specimen		K_{Jc} (MPa√m)		δ_j
	Type	Size	Raw data	1T equivalent	
-130	C(T)	1/2T	59.5	53.2	1
			85.1	74.7	1
			55.3	49.7	1
			56.4	50.6	1
-80	C(T)	1/2T	51.3	46.3	1
			87.9	77.1	1
			113.4	98.5	1
-65	SE(B)	1T	73.9	73.9	1
-55	C(T)	1/2T	126.8	126.8	1
			167.7	144.2	1
			88.5	77.6	1
			115.2	100.0	1
			81.4	71.6	1
			121.9	105.7	1
			145.0	125.1	1
			104.2	90.8	1
			64.4	57.3	1
			96.8	84.6	1
			114.5	99.5	1
			107.4	93.5	1
			81.0	71.3	1
			70.0	62.0	1
			131.8	114.0	1
-30	C(T)	1/2T	69.5	61.6	1
			67.5	59.9	1
			102.3	89.2	1
			194.0	166.3	1
			170.4	146.5	1
			129.5	112.1	1
			118.2	102.6	1
			147.9	127.5	1
			178.8	153.5	1
			95.9	83.8	1
-20	SE(B)	1T	135.1	135.1	1
			108.9	108.9	1
			177.1	177.1	1
			141.7	141.7	1
			174.4	174.4	1
			84.8	84.8	1
-10	C(T)	1/2T	132.1	132.1	1
			211.4	180.9	1
			179.9	154.5	1
			171.8	147.6	1
			153.0	131.8	1
-5	C(T)	1/2T	236.9	(204)	0
			156.8	135	1
			121.5	105.3	1
			194.2	166.5	1
			110.4	96.0	1
			197.0	168.8	1
			134.7	116.5	1
0	C(T)	1/2T	264.4	(203)	0
			277.8	(198.9)	0
			218.9	187.2	1
			107.7	93.7	1
			269.3	(203)	0
23	C(T)	1/2T	327.1	(203)	0
			325 ^A	(202)	0
			328 ^A	(202)	0
			227	194	1

^A R-curve (no cleavage instability).

$$T_o = -48^{\circ}\text{C}$$

The valid test temperature range is -98°C to 2°C . Original calculations were performed with data in this regime. Therefore, no iteration is required.

X3.8 Qualified Data Summation:

$(T - T_o)$ range (°C)	Number of valid tests, r_i	Weight factor, n_i	$r_i \cdot n_i$
50 to -14	43	1/6	7.2
-15 to -35	5	1/7	0.7
-36 to -50	0	1/8	0

Validity check:

$$\sum r_i n_i = 7.9 > 1.0$$

X4. CALCULATION OF TOLERANCE BOUNDS

X4.1 The standard deviation of the fitted Weibull distribution is a mathematical function of Weibull slope, $K_{Jc(med)}$, and K_{min} , and because two of these are constant values, the standard deviation is easily determined. Specifically, with slope b of 4 and $K_{min} = 20 \text{ MPa}\sqrt{\text{m}}$, standard deviation is defined by the following (214):

$$\sigma = 0.28 K_{Jc(med)} [1 - 20/K_{Jc(med)}] \quad (\text{X4.1})$$

X4.1.1 *Tolerance Bounds*—Both upper and lower tolerance bounds can be calculated using the following equation:

$$K_{Jc(0.xx)} = 20 + \left[\ln \left(\frac{1}{1 - 0.xx} \right) \right]^{1/4} \{11 + 77 \exp [0.019(T - T_o)]\} \quad (\text{X4.2})$$

where temperature “ T ” is the independent variable of the equation; xx represents the selected cumulative probability level; for example, for 2 % tolerance bound, $0.xx = 0.02$. As an example, the 5 and 95 % bounds on the Appendix X2 master curve are:

$$K_{Jc(0.05)} = 25.2 + 36.6 \exp [0.019(T + 80)] \quad (\text{X4.3})$$

$$K_{Jc(0.95)} = 34.5 + 101.3 \exp [0.019(T + 80)]$$

X4.1.2 The potential error due to finite sample size can be considered, in terms of T_o , by calculating a margin adjustment, as described in X4.2.

X4.2 *Margin Adjustment* —The margin adjustment is an upward temperature shift of the tolerance bound curve, Eq X4.3. Margin is added to cover the uncertainty in T_o that is associated with the use of only a few specimens to establish T_o . The standard deviation on the estimate on T_o is given by:

$$\sigma = \beta / \sqrt{r} \text{ (°C)}, \quad (\text{X4.4})$$

where:

r = total number of specimens used to establish the value of T_o .

X4.2.1 When $K_{Jc(med)}$ is equal to or greater than $83 \text{ MPa}\sqrt{\text{m}}$, $\beta = 18^\circ\text{C}$ (225). If the 1T equivalent $K_{Jc(med)}$ is below $83 \text{ MPa}\sqrt{\text{m}}$, values of β must be increased according to the following schedule:

$K_{Jc(med)}$ 1T equivalent ^A ($\text{MPa}\sqrt{\text{m}}$)	β (°C)
83 to 66	18.8
65 to 58	20.1

^A Round off $K_{Jc(med)}$ to nearest whole number.

X4.2.2 To estimate the uncertainty in T_o , a standard two-tail normal deviate, Z , should be taken from statistical handbook tabulations. The selection of the confidence limit for T_o adjustment is a matter for engineering judgment. The following example calculation is for 85 % confidence (two-tail) adjustment to Eq X4.3 for the six specimens used to determine T_o .

$$\Delta T_o = \sigma(Z_{85}) = \frac{18}{\sqrt{6}} (1.44) = 10^\circ\text{C} \quad (\text{X4.5})$$

$$T_o (\text{margin}) = T_o + \Delta T_o = -80^\circ + 10^\circ = -70^\circ\text{C}$$

Then the margin-adjusted 5 % tolerance bound of Eq X4.3 is revised to:

$$K_{Jc(05)} = 25.2 + 36.6 \exp [0.019(T + 70)] \quad (\text{X4.6})$$

Eq X4.6 is plotted in Fig. X4.2 as the dashed line (L.B.).

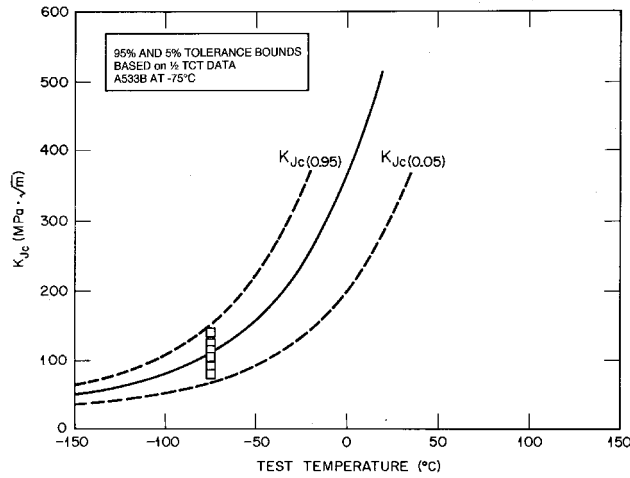


FIG. X4.1 Master Curve With Upper and Lower 95 % Tolerance Bounds

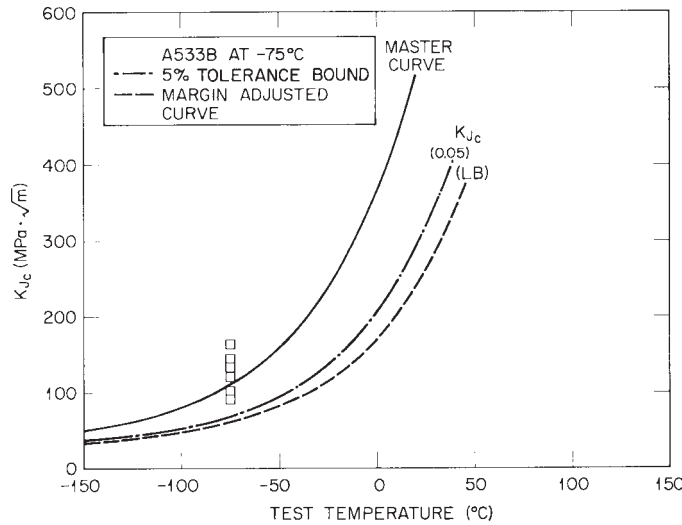


FIG. X4.2 Master Curve Showing the Difference Between 5 % Tolerance Bound and Lower Bound That Includes 85 % Confidence Margin on T_o

REFERENCES

- (1) Gao, X, and Dodds, R. H., "Constraint Effects on the Ductile-to-Cleavage Transition Temperature of Ferritic Steels: A Weibull Stress Model," *International Journal of Fracture*, 102, 2000, pp. 43-69.
- (2) Wallin, K., Planman, T., Valo, M., and Rintamaa, R., "Applicability of Miniature Size Bend Specimens to Determine the Master Curve Reference Temperature T_o ," *Engineering Fracture Mechanics*, Vol 68, 2001, pp. 1265-1296.
- (3) Joyce, J. A., and Tregoning, R. L., "Investigation of Specimen Geometry Effects and Material Inhomogeneity Effects in A533B Steel," *ECF 14—Fracture Mechanics Beyond 2000, Proceedings of the 14th European Conference on Fracture*, Krakow, September 2002, to be published.
- (4) Anderson, T. L., Steinstra, D., and Dodds, R. H., "A Theoretical Framework for Addressing Fracture in the Ductile-Brittle Transition Region," *Fracture Mechanics*, 24th Volume, *ASTM STP 1207*, ASTM, 1994, pp. 185-214.
- (5) Ruggeri, C., Dodds, R.H., and Wallin, K., "Constraint Effects on Reference Temperature, T_o , for Ferritic Steels in the Transition Region," *Engineering Fracture Mechanics*, 60(1), 1998, pp. 19-36.
- (6) Paris, P. C., "Fracture Mechanics in the Elastic-Plastic Regime," *Flaw Growth in Fracture*, *ASTM STP 631*, ASTM, August 1976, pp. 3-27.
- (7) Turner, C. E., "The Eta Factor," *Post Yield Fracture Mechanics*, Second Ed., Elsevier Applied Science Publishers, London and New York, 1984, pp. 451-459.
- (8) McCabe, D. E., *Evaluation of Crack Pop-ins and the Determination of their Relevance to Design Considerations*, NUREG/CR-5952 (ORNL/TM-12247), February 1993.
- (9) Wallin, K., "The Scatter in K_{Ic} Results," *Engineering Fracture Mechanics*, 19(6) (1984), pp. 1085-1093.
- (10) McCabe, D. E., Zerbst, U., and Heerens, J., "Development of Test Practice Requirements for a Standard Method of Fracture Toughness Testing in the Transition Range," *GKSS Report 93/E/81*, GKSS Forschungszentrum, Geesthacht, GmBH, Germany, 1993.

- **(811)** Steinstra, D. I. A., “Stochastic Micromechanical Modeling of Cleavage Fracture in the Ductile-Brittle Transition Region,” MM6013-90-11, Ph.D. Thesis, Texas A & M University, College Station, TX, August 1990.
- **(912)** Wallin, K., “A Simple Theoretical Charpy V-K_{Jc} Correlation for Irradiation Embrittlement,” *ASME Pressure Vessels and Piping Conference, Innovative Approaches to Irradiation Damage and Fracture Analysis*, PVP-Vol 170, American Society of Mechanical Engineers, New York, July 1989.
- **(1013)** Heerens, J., Read, D. T., Cornec, A., and Schwalbe, K.-H., “Interpretation of Fracture Toughness in the Ductile-to-Brittle Transition Region by Fractographical Observations,” *Defect Assessment in Components - Fundamentals and Applications*, J. G. Blauel and K. H. Schwalbe, eds.,ESIS/EGF9, Mechanical Engineering Publications, London, 1991, pp. 659-78.
- **(1114)** Landes, J. D., and McCabe, D. E., “Effect of Section Size on Transition Temperature Behavior of Structural Steels,” *Fracture Mechanics: Fifteenth Symposium, ASTM STP 833*, ASTM, 1984, pp. 378-392.
- **(1215)** Wallin, K., “Recommendations for the Application of Fracture Toughness Data for Structural Integrity Assessments,” *Proceedings of the Joint IAEA/CSNI Specialists Meeting on Fracture Mechanics Verification by Large-Scale Testing*, NUREG/CP-0131 (ORNL/TM-12413), October 1993, pp. 465-494.
- **(1316)** Kirk, M. T., and Dodds, R. H., “J and CTOD Estimation Equations for Shallow Cracks in Single Edge Notch Bond Specimens,” *Journal of Testing and Evaluation, JTEVA*, Vol 21, No. 4, July 1993, pp. 228-238.
- **(1417)** Scibetta, M., “3-D Finite Element Simulation of the PCCv Specimen Statically Loaded in Three-Point Bending,” (report R-3440) report BLG-860, SCK*CEN Mol, Belgium, March 2000.
- **(1518)** Schwalbe, K. H., Hellmann, D., Heerens, J., Knaack, J., and Mueller-Roos, J., “Measurement of Stable Crack Growth Including Detection of Initiation of Growth Using Potential Drop and Partial Unloading Methods,” *Elastic-Plastic Fracture Test Methods, Users Experience, ASTM STP 856*, ASTM, 1983, pp. 338-62
- **(1619)** Landes, J. D., “J Calculation from Front Face Displacement Measurements of a Compact Specimen,” *International Journal of Fracture*, Vol 16, 1980, pp. R183-86.
- **(1720)** Sokolov, M. A., and Nanstad, R. K., “Comparison of Irradiation-Induced Shifts of K_{Jc} and Charpy Impact Toughness for Reactor Pressure Vessel Steels,” in *Effects of Radiation on Materials: 18th International Symposium, ASTM STP 1325*, R. K. Nanstad, M. L. Hamilton, F. A. Garner, and A. S. Kumar, Eds., American Society for Testing and Materials, West Conshohocken, PA, 1999, pp. 167-190.
- **(1821)** Wallin, K., “Validity of Small Specimen Fracture Toughness Estimates Neglecting Constraint Corrections,” in *Constraint Effects in Fracture: Theory and Applications, ASTM STP 1244*, M. Kirk and A. Bakker, eds., ASTM, 1994, pp. 519-537.
- **(1922)** ASME Boiler and Pressure Vessel Code. An American National Standard, Sect. XI, “Rules for Inservice Inspection of Nuclear Power Plant Components,” Article A-4000, American Society of Mechanical Engineers, New York, 1993.
- **(2023)** Merkle, J. G., Wallin, K., and McCabe, D. E., *Technical Basis for an ASTM Standard on Determining the Reference Temperature, T_o for Ferritic Steels in the Transition Range*, NUREG/CR-5504 (ORNL/TM-13631), November 1998.
- **(2124)** Johnson, L. G., *The Statistical Treatment of Fatigue Experiments*, Elsevier, NY, 1957.
- **(2225)** Wallin, K., *Master Curve Analysis of Ductile to Brittle Transition Region Fracture Toughness Round Robin Data (The Euro Fracture Toughness Curve)*, VTT Technical Document 367.58P, Espoo, Finland, 1998.

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org).